



Reaction to fire test report

Test standard: Ad-hoc test based off ISO 13785-1:2002

Test sponsor: Cladding Safety Victoria (CSV)

System: Aluminium composite panel (ACP) and glazing external wall cladding system

Job number: RTF230140

Test date: 9 May 2024 Revision: R3.0



Quality management

| Revision | Date | Information | about the report | | |
|---|-------------|-------------|------------------|-------------|---------------|
| R3.0 | 31 May 2024 | Description | Initial issue. | | |
| | | | Prepared by | Reviewed by | Authorised by |
| | | Name | | | |
| | | Signature | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| Warringtonfire* Australia Pty Ltd ABN 81 050 241 524 | | | | | |

*As used herein, The name "Warringtonfire" and its associated IP and branding is used by Warringtonfire Australia Pty Limited in Australia under licence from Warringtonfire Testing and Certification Limited (based in the UK) for a transitional period following the acquisition of Warringtonfire Australia Pty Limited. The Warringtonfire Testing and Certification Limited continues to own the rights to "Warringtonfire" and continues to operate the global "Warringtonfire business" outside of Australia.

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140

Test sponsor: Cladding Safety Victoria (CSV)

Revision: R3.0 Page 2 of 45



Contents

| 1. | Introduct | ion | 4 |
|-------------------|--|----------------------------------|----------------|
| 2. | Test spec | cimen | 4 |
| 2.1 | Schedule c | of components | 4 |
| 3. | Test prod | cedure | g |
| 4. | Test mea | asurements and results | 10 |
| 5. | Application | on of test results | 20 |
| 5.1 5.2 5.3 | Test limitati Variations t Uncertainty | ions from the tested specimen | 20 20 20 |
| Арре | endix A | Drawings of test assembly | 21 |
| Appe | endix B | Photographs | 32 |
| Appe | Appendix C Chemical Analysis Results | | |



1. Introduction

This report documents the findings of test three of three ad-hoc reaction to fire tests for an Aluminium composite panel (ACP) and glazing external wall cladding system performed on 9 May 2024. The test was based off some general requirements of ISO 13785-1:2002.

Warringtonfire performed the test at the request of the test sponsor listed in Table 1.

Table 1 Test sponsor details

| Test sponsor | Address |
|--------------------------------|---------------------------------------|
| Cladding Safety Victoria (CSV) | 717 Bourke Street Docklands, VIC 3808 |
| | Australia |

2. Test specimen

2.1 Schedule of components

Table 2 describes the test specimen and lists the schedule of components. These were provided by the representatives of the test sponsor and surveyed by Warringtonfire. All measurements were done by Warringtonfire – unless indicated otherwise.

Detailed drawings of the test specimen are provided in Appendix A.

Table 2 Schedule of components

| Item | Description | | | |
|-------|-------------------------|--|--|--|
| Clado | ding | | | |
| 1. | Item name | Aluminium composite panel (ACP) panel | | |
| | Product | Aluminium Composite Panel - 4 mm White G | iloss/Grey | |
| | Manufacturer/Supplier | | | |
| | Note on Supply of Panel | On behalf of CSV, Warringtonfire acquired th core. To the best of Warringtonfire's knowled which the supplier doesn't normally supply. T basis that this was for research purposes and testing. | ge this is a custom production The panels were provided on the | |
| | Material | The material was nominated as panels consisting of two layers of aluminium sheets sandwiching a layer (core) with 100 % polyethylene (PE). Analysis conducted by the analytical centre of UNSW showed that the core | | |
| | | consisted of polyethylene (PE) - found to be 96 % w/w - whilst the remainder of the material was found to be 3.3 % inert material. | | |
| | | Refer to Appendix C for more detailed results | S. | |
| | Colour | Skins | Front skin – Gloss white Back skin – Light grey | |
| | | Core | Black | |
| | Size | Total panel thickness – 4.0 mm | | |
| | | Skin thickness – 0.5 mm (both) | | |
| | | Uncut: 4.0 m × 1.22 m | | |
| | | Refer to Appendix A for individual panel sizing details. | | |
| | Batch | | | |
| | Areal density | 5.6 kg/m² (measured) | | |

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140



| Item | Description | | | | |
|-------|-----------------------|---|--|--|--|
| 2. | Item name | Back-pan | | | |
| | Product | Nominally 0.9 mm thick Galvabond sheet measured 0.6 mm | | | |
| | Supplier | | | | |
| | Material | Galvanised steel | | | |
| | Batch | | | | |
| | Size | 1160 mm wide × 3700 mm tall, 0.6 mm thick – in segments. | | | |
| Glazi | ng | | | | |
| 3. | Item name | Double glazing | | | |
| | Material | 6 mm Clear Heat Strengthened\12B (Argon filled cavity) \6.5 HU | | | |
| | Size (nominal) | 1188 mm wide × 1800 mm tall × 6 mm/12 mm/6.5 mm with a 12 mm black spacer. | | | |
| | Manufacturer/Supplier | | | | |
| | Batch | | | | |
| 4. | Item name | Single glazing | | | |
| | Material | 6 mm Clear Heat Strengthened | | | |
| | Size (nominal) | 1182 mm wide × 1800 mm tall × 6 mm thick | | | |
| | Manufacturer/Supplier | | | | |
| | Batch | | | | |
| Fram | ing | | | | |
| 5. | Item name | Test rig frame - 90 × 90 SHS and 200 × 90 PFC frame | | | |
| | Material | Painted steel | | | |
| | Size | 90 mm \times 90 mm \times 5 mm thick and 200 mm \times 90 mm \times 10 mm thick – refer to Figure 13. | | | |
| 6. | Item name | Aluminium curtain wall transom/mullions (rectangular hollow sections) – framing | | | |
| | Material | Aluminium | | | |
| | Size | 65 mm to 70 mm wide × 116 mm deep × 3 mm thick. | | | |
| | Manufacturer/Supplier | | | | |
| 7. | Item name | Aluminium angles - framing | | | |
| | Size | 25 mm wide × 50 mm deep × 3 mm thick | | | |
| | Material | Aluminium | | | |
| | Manufacturer/Supplier | | | | |
| 8. | Item name | Aluminium angles – for middle double back-pan unit. | | | |
| | Size | 25 mm wide × 50 mm deep × 3 mm thick | | | |
| | Material | Aluminium | | | |
| | Manufacturer/Supplier | | | | |
| | Installation | Used to secure the secondary back-pan in the within the middle module. The angle was screw fixed to both the back-pan (item 1) and the aluminium framing (item 6) using screws (item 18). | | | |



| Item | Description | | | | |
|---|-----------------------|---|--|--|--|
| 9. | Item name | Aluminium stiffener - framing | | | |
| | Size | 3 mm thick × 150 mm deep | | | |
| | Material | Aluminium | | | |
| | Manufacturer/Supplier | | | | |
| 10. | Item name | Curtain wall bracket | | | |
| | Size | 150 mm deep (7 mm thick) × 75 tall (10 mm thick) × 100 mm wide | | | |
| | Installation | Used to secure the 3 modules to the test rig using tek screws. | | | |
| Smok | ke seal | | | | |
| 11. | Item name | Smoke seal | | | |
| | Size | 0.55 mm thick galvanised steel | | | |
| | Manufacturer/Supplier | | | | |
| Pene | tration | | | | |
| 12. | Item name | Exhaust | | | |
| | Size | Backing plates: 355 mm × 355 mm × 0.6 mm thick | | | |
| | | Large tube: Ø150 mm × 600 mm long × 0.5 mm thick | | | |
| | | Cap: Ø240 mm × 85 mm deep × 0.6 mm thick | | | |
| | | Connecting strips: 45 mm × 5 mm wide × 0.5 mm thick | | | |
| | Material | Galvanised steel | | | |
| | Manufacturer/Supplier | | | | |
| | Pictures | | | | |
| | | Exposed side Unexposed side | | | |
| | Installation | The penetrating element was a galvanised steel tube. On the glazing side was a circular weather cowl. A square compartment made from galvanised steel which hid the tubing was installed between the glazing and the inner backpan. | | | |
| Insul | ation | | | | |
| 13. | Item name | 90 mm thick polyethylene terephthalate (PET) insulation | | | |
| | Density | 10 kg/m³ | | | |
| | Manufacturer/Supplier | | | | |
| 14. | Item name | 50 mm thick aluminium - with fibre-glass mesh - foil faced rockwool insulation | | | |
| | Density of core | 40 kg/m ³ | | | |
| | Manufacturer/Supplier | | | | |
| Seala | int/Adhesive | | | | |
| 15. Item name Weathering sealant - silicone sealant | | Weathering sealant - silicone sealant | | | |
| | Product name | | | | |



| Item | Description | |
|--------|-----------------------|--|
| | Manufacturer/Supplier | |
| | Usage | Placed at ACP edges and screw and rivet locations. |
| 16. | Item name | Back-pan sealant - Fire-rated mastic |
| | Product name | |
| | Manufacturer/Supplier | |
| | Usage | Used between the back-pans (item 1) and the aluminium framing (item 7). |
| 17. | Item name | Penetration sealant |
| | Product name | |
| | Manufacturer/Supplier | |
| | Usage | Used between the back-pans (item 1) and the aluminium framing (item 7). |
| Fixin | gs | |
| 18. | Item name | Tek screws SDS – zinc coated steel – for fixing the back-pan |
| | Size | 10g × 24 mm long |
| | Installation | Used to fix aluminium angles (item 8) to the aluminium frame (item 6) at max. 500 mm centres |
| 19. | Item name | Wafer head screws – zinc coated steel |
| | Size | 10g × 16 mm long |
| | Installation | Used to fix aluminium angles (item 8) to the aluminium frame (item 6) at max. 500 mm centres |
| 20. | Item name | Wafer head screws – zinc coated steel |
| | Size | 10g × 20 mm long |
| | Installation | Used to fix the penetration backing plate (item 12) to the back-pan (item 2) of the central module. |
| 21. | Item name | Wafer head screws – zinc coated steel |
| | Size | 10g × 21 mm long |
| | Installation | Used to fix ACP (item1) to the aluminium stiffener (item 9) – four per corner. |
| 22. | Item name | Aluminium rivets |
| | Size | Ø4 mm |
| 23. | Item name | Fast-fix washers and pin weld (to hold insulation) |
| | Size | 115 mm × 3 mm pins and 25 mm × 25 mm fast fix washers. |
| 24. | Item name | Tek screws for curtain wall bracket |
| | Size | 14 g × 35 mm long |
| 25. | Item name | Tek screws for smoke seal to false slab i.e. C-Purlin |
| | Size | 14 g × 35 mm long |
| Insta | llation method | |
| Test r | ig: | The test rig frame (item 5) was the main support for the test specimen, however, there were two C-purlin sections that acted as false slabs (200 mm tall). The test specimen, 3-off modules – interconnected through aluminium framing (item 6), was fixed to the test rig using curtain wall brackets (item 10) and fixings (item 24) – see Figure 15 & Figure 17. Each module extended from the bottom of the specimen to the top. |



| A Jensen F | -lughes | Compan | У |
|------------|---------|--------|---|
|------------|---------|--------|---|

| Item Description | |
|------------------|--|
| Framing: | The main framing for the external wall was composed of aluminium extrusions (item 6) which were screw fixed together. Aluminium angles (item 8) – horizontal edges - and stiffeners (item 9) – on the vertical edges - were fixed to the aluminium framing (item 6), using wafer head screws (item 20) and aluminium rivets (item 22), respectively. |
| Cladding: | The front face of the specimen was cladded with cassetted ACPs (item1), which were fixed to the aluminium stiffeners (item 9) and the aluminium angles (item 8) using aluminium rivets (item 22), 2-off at 300 mm centres. See Figure 14 for panel locations. |
| | The back side of the framing was closed off with steel back-pans (item 1) screw fixed (item 18) at 300 mm centres. PET insulation (item 13) was fixed to the back-pan using fast-fix washers and pin combinations (item 19) that were welded to the back-pan. The centre module had an extra back-pan behind the glazing (item 4). This was fixed to the aluminium framing (item 6) using screws (item 18) and aluminium angles (item 8). Foil-faced rockwool insulation (item 14) was inserted between the two back-pans (item 1) of the centre module. |
| Glazing | The glazing, both double (item 3) and single (item 4), were attached to the aluminium framing (item 6) as shown in Figure 14 to Figure 24 and Figure 27. The glazing was sealed around the perimeter with weather sealant (item 15). |
| Smoke seal | Smoke seal barrier (item 11) was attached to C-purlins of the test rig (item 5) with screw fixings (item 24) at approximate 600 mm centres. PET insulation (item 13) was installed into the 60 mm wide cavity above the barrier (item 12). |
| Penetration | The penetration went through holes in the single glazing (item 4) and backpans (item 1) of the second module. These were fixed to the back-pan and the window with a steel sheet (backing plate), using screws and sealant and just sealant, respectively. |



Test procedure 3.

Table 3 details the test procedure for this reaction to fire test.

Table 3 **Test procedure**

| able 3 rest procedure | | | |
|-------------------------------|--|--|--|
| Item | Detail | | |
| Statement of compliance | The ad-hoc test – which was based off ISO 13785-1:2002 - was performed to determine the reaction to fire performance of an external wall cladding when exposed to heat from a simulated external fire with flames impinging directly upon a façade. The test utilises a burner used in ISO 13785-1:2002. | | |
| Sampling / specimen selection | The laboratory was not involved in sampling or selecting the test specimen for the reaction to fire test. The results obtained during the test only apply to the test samples as received and tested by Warringtonfire. | | |
| Test duration | 60 minutes | | |
| Instrumentation and equipment | 21 mineral insulated metal sheathed (MIMS) Type K thermocouples with an overall diameter of 1.5 mm with the measuring junction insulated from the sheath were positioned 60 mm in front of the outer ACP face of the test specimen. Refer to Figure 1 for details on positioning. | | |
| | The incident heat flux on the top of the specimen in line with the front face of test specimen was measured using a Schmidt-Boelter type heat flux gauge with a range of 0-20 kW/m². | | |
| | The incident heat flux 500 mm behind the outer glazing's – burner side and non-burner side – was measured using two Schmidt-Boelter type heat flux gauges with a range of 0-20 kW/m². | | |
| | The incident heat flux 80 mm behind the central glazing was measured using a Schmidt-Boelter type heat flux gauge with a range of 0-20 kW/m². | | |
| | Temperatures above and below the cladding were measured by seven 100 mm × 100 mm × 0.7 mm plate thermocouples with mineral insulated metal sheathed (MIMS) Type K thermocouples with an overall diameter of 1 mm with the measuring junction electrically insulated from the sheath. The thermocouple hot junction was fixed to the geometric centre of the plate by a small steel strip made from the same material as the plate. The plate thermocouples included 97 mm × 97 mm × 10 mm inorganic insulation pads. Before the first use of the plate thermocouples, they were aged by being exposed to heat in a fire-resistance test furnace for 90 min under the standard temperature/ time curve. Refer to Figure 1 for details on positioning. | | |
| | The fire source was a propane (95% purity) gas burner 1.2 m long × 0.1 m deep × 0.15 m tall. The burner was placed on the floor below the specimen with approximately 15 mm overlap with the ACP. | | |
| Test procedure | At least two minutes of baseline data was collected prior to burner ignition. Temperature and heat flux data was collected at 5 s intervals. The heat output from the burner was held at 300 kW for the 30 minutes. The burner was then turned off and data recorded for the next 30 minutes. | | |
| Test number | Test three of three. | | |
| Variation to test one | The sideboard was 1 metre high, while it was 300 mm for test one. The laboratory conditions during the tests may differ. | | |

Test standard: General accordance with ISO 13785-1:2002



4. Test measurements and results

The results from the tests are summarized below. Photographs of the specimen are included in Appendix B.



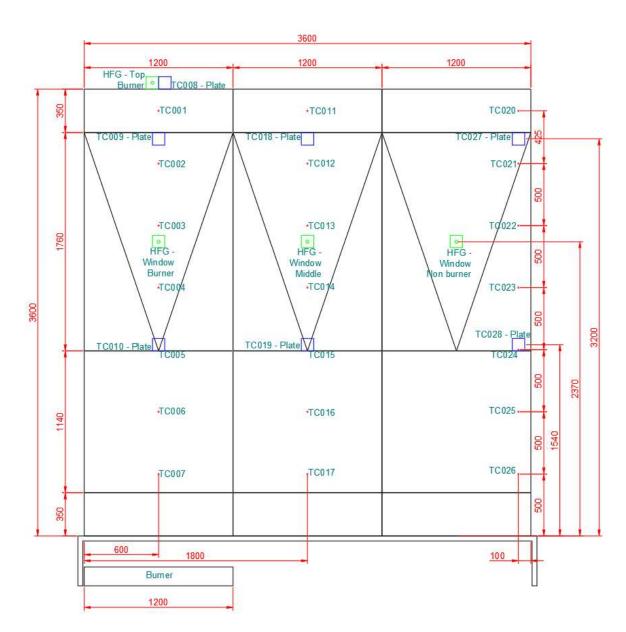


Figure 1 Instrumentation locations – front elevation

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140 Test sponsor: Cladding Safety Victoria (CSV)

ctoria (CSV)

Revision: R3.0
Page 10 of 45





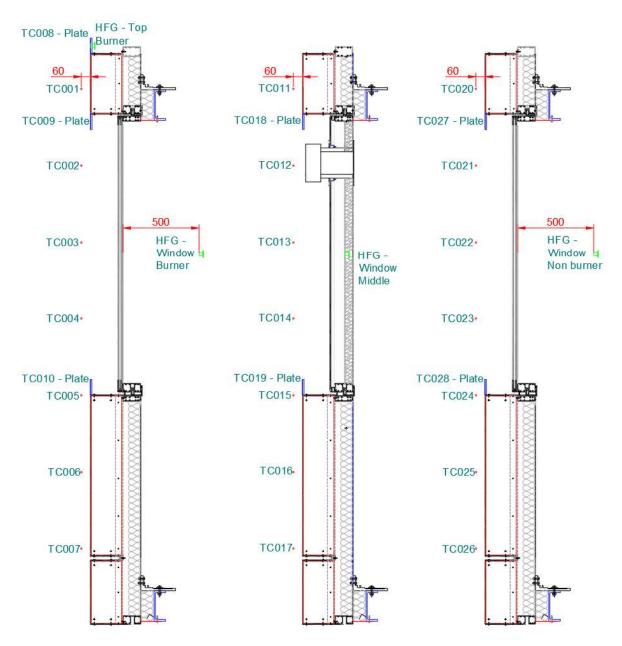


Figure 2 Instrumentation locations – sections

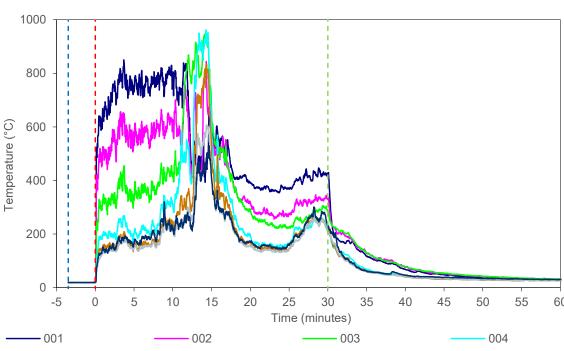

60 - 005 - 007 - - Burner ignition 006 --- Burner off - - - Data start

External temperature data collected by thermocouples placed 60 mm from the front face of the specimen - in-line with the burner

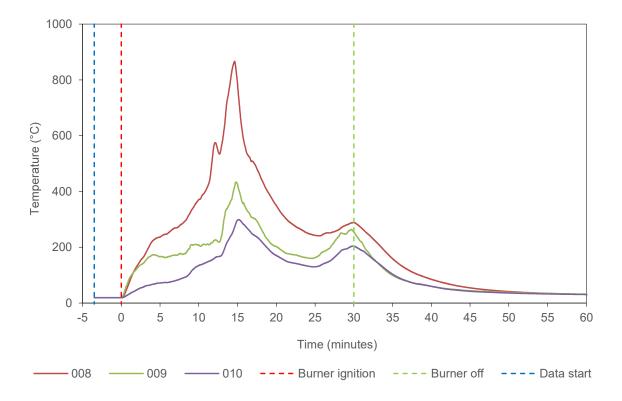

External temperature data collected by plate thermocouples in-line with ACP, above and below, respectively - in-line with the burner

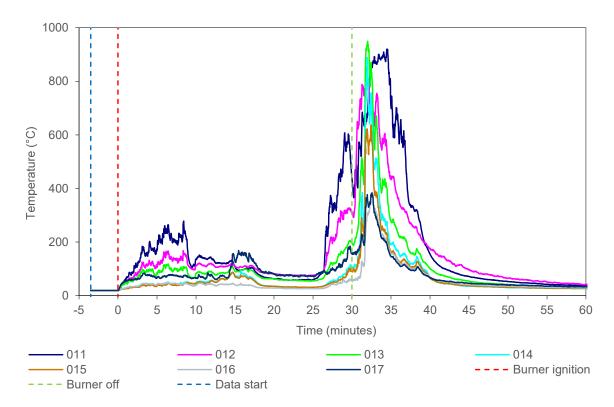


Figure 5 External temperature data collected by thermocouples placed 60 mm from the front face of the specimen – central module

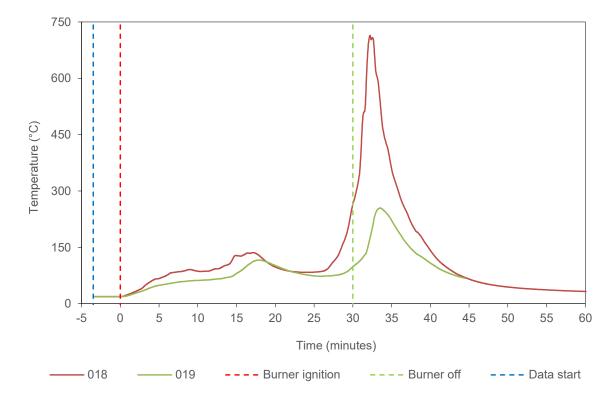


Figure 6 External temperature data collected by thermocouples in-line with ACP, above and below, respectively – central module

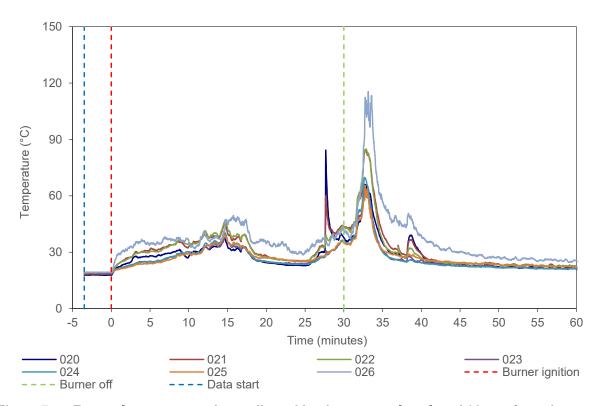


Figure 7 External temperature data collected by thermocouples placed 60 mm from the front face of the specimen – away from burner

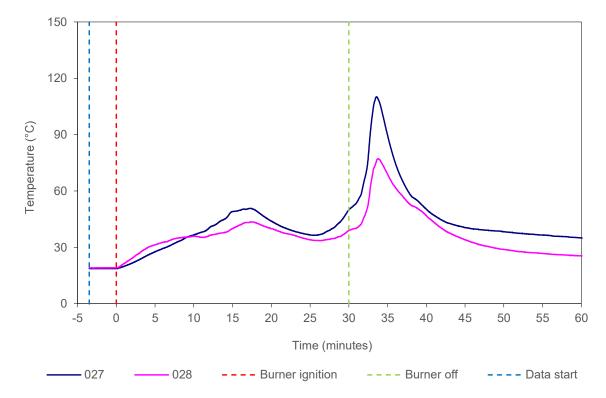


Figure 8 External temperature data collected by thermocouples in-line with ACP, above and below, respectively – away from burner



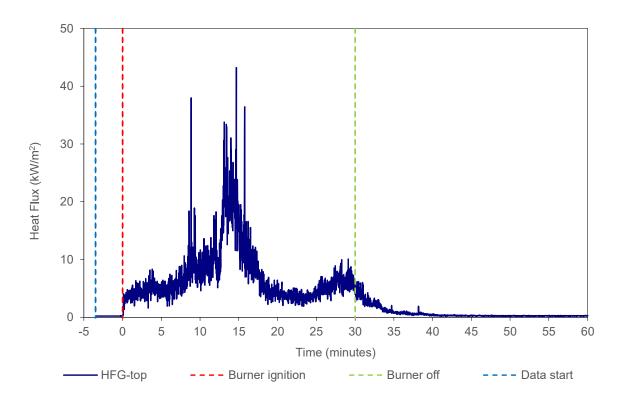


Figure 9 Heat flux data collected by heat flux gauge at the top of the specimen above the burner

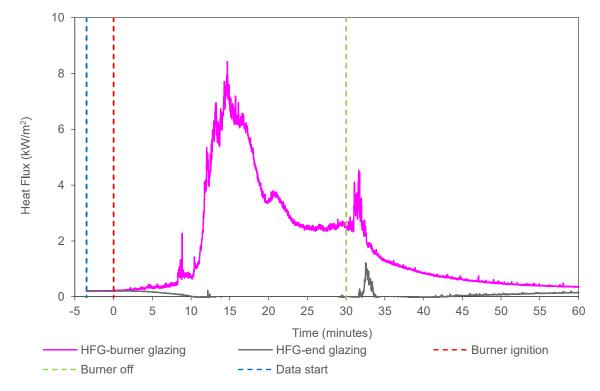


Figure 10 Heat flux data collected by heat flux gauges behind the double glazed units



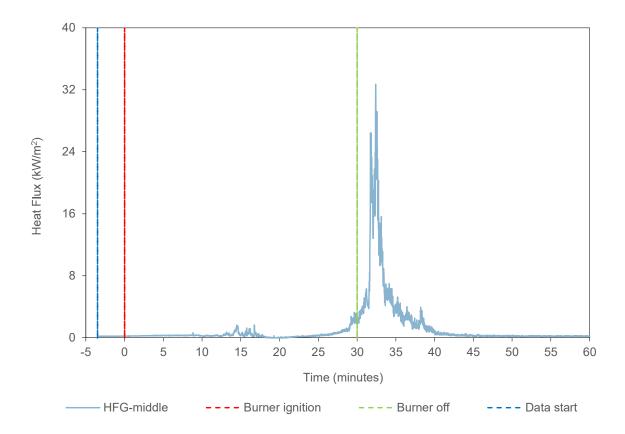


Figure 11 Heat flux data collected by heat flux gauge behind the single glazed unit



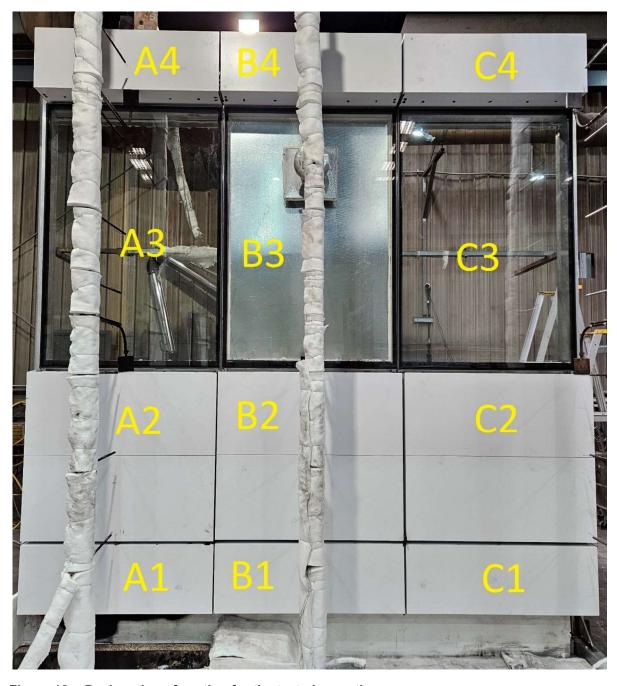


Figure 12 Designation of section for the test observations

Table 4 shows the observations of any significant behaviour of the specimen during the test. Figure 12 shows the panel and glazing designations sighted in the observations.

Video recordings were also taken of the test from approximately 4 metres in front of the specimen and from 2 metres on a 45 ° angle behind the specimen. A copy of the video recording is available upon request from the test sponsor or by contacting Cladding Safety Victoria. The video of the test should be viewed in conjunction with the contents of this report.



Table 4 **Test observations**

| Time System Observation Min Sec -3 32 - Data collection started. 0 00 - The reaction to fire test was started with the burner ignited with a heat output set at 300 kW. 0 52 A1/A2 The panel face started to darken. 1 02 A2 More of the panel face had discoloured. 1 13 A3 The flames started to bottom of the glazing. 1 25 A2 The flames started to scape from the unexposed side. 2 30 B2 Smoke started to escape from the unexposed side. 3 30 C1 Smoke started to escape from the unexposed side. 3 30 C1 Smoke started to escape from the bottom of the panel. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 4 19 A1/A2 Molten debris started to seep between the glazing layers. 7 45 A3 Smoke started to seep between the g | | | rest obser | | |
|--|------|-----|------------|---|--|
| -3 32 - Data collection started. 0 00 - The reaction to fire test was started with the burner ignited with a heat output set at 300 kW. 0 52 A1/A2 The panel face started to darken. 1 02 A2 More of the panel face had discoloured. 1 13 A3 The flames had reached the bottom of the glazing. 1 25 A2 The flames started to spread laterally across to B2. 1 50 A3 The bottom of the glazing started to smoke. 2 30 B2 Smoke started to escape from the unexposed side. 3 30 C1 Smoke started to escape from the unexposed side. 3 30 C1 Smoke started to escape from the bottom of the panel. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 4 55 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to spread across the bottom of the glazing. | Time | | | Observation | |
| The reaction to fire test was started with the burner ignited with a heat output set at 300 kW. | Min | Sec | | | |
| at 300 kW. 1 | -3 | 32 | - | Data collection started. | |
| 1 02 A2 More of the panel face had discoloured. 1 13 A3 The flames had reached the bottom of the glazing. 1 25 A2 The flames started to spread laterally across to B2. 1 50 A3 The bottom of the glazing started to smoke. 2 30 B2 Smoke started to escape from the unexposed side, 3 05 A/B Smoke started to escape from the vertical joint between the two modules. 3 30 C1 Smoke started to escape from the bottom of the panel. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 4 55 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to seep between the glazing layers. 7 45 A3 Flames started to spread across the bottom of the glazing. 8 18 A1 The face had opened up. 8 42 A2/A3 The flaming in the area had increased in intensity. 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel started to open up. 11 A3 The glazing layers started to open up. 12 B1 The bottom of the panel flamed independently. 13 A1/A2 Flames started spreading across the panel to panel joint. 14 A3 The glazing started to rack and shatter off. 15 A6 A/B Flames started spreading across the panel to panel joint. 16 S9 A3 Some glazing shattered and fell on the unexposed side. 17 The panel face collapsed off the specimen. 18 A9 A7/A2 The panel face started to open up. 18 B2 The panel face started to open up. 19 B3 A7/B Flames started escaping from the top of the vertical joint between the modules. 19 B2 The panel face started to rack and shatter off. 19 A3 Some glazing shattered and fell on the unexposed side. 19 A3 A7/B Flames had breached into the back of the panel. 20 A3 The flaming from the top of the vertical joint between the modules. 21 The flames had breached into the unexposed side. 22 A3 The flames had breached into the unexposed side. 23 B2 The flames had breached into the unexposed side. 24 S8 B1 The panel face started to breach on to the unexposed side. 25 B3 B7 The | 0 | 00 | - | | |
| 1 13 A3 The flames had reached the bottom of the glazing. 1 25 A2 The flames started to spread laterally across to B2. 1 50 A3 The bottom of the glazing started to smoke. 2 30 B2 Smoke started to escape from the unexposed side. 3 05 A/B Smoke started to escape from the vertical joint between the two modules. 3 30 C1 Smoke started to escape from the bottom of the panel. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 5 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to seep between the glazing layers. 7 45 A3 Flames started to spread across the bottom of the glazing. 8 18 A1 The face had opened up. 8 42 A2/A3 The flaming in the area had increased in intensity. 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 42 A3 The glazing layers started to open up. 10 28 B1 The bottom of the panel started to open up. 11 A1 A3 The glazing started to rack and shatter off. 12 A1/A2 The panel face collapsed off the specimen. 13 A3 Smoke started escaping from the top of the vertical joint between the modules. 14 A0 A1/A2 The panel face collapsed off the specimen. 15 B2 The panel face started to open up. 16 59 A3 Some glazing shattered to open up. 17 The panel face bacaping from the top of the vertical joint between the modules. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 55 B2 The flames started to breach on to the unexposed side of the specimen. 19 Flames started to breached into the back of the panel. 20 A3 The flames had breached on the unexposed side of the specimen. 21 15 A1/A2 Flames started to breach on to the unexposed side. 23 B2 The flames had breached to the unexposed side of the specimen. 24 25 A3 The flames had breached to the orthe of the vertical joint between the modules. 25 B3 B6 The flames had breached to pot the vertical joint between the modules. | 0 | 52 | A1/A2 | The panel face started to darken. | |
| 1 25 A2 The flames started to spread laterally across to B2. 1 50 A3 The bottom of the glazing started to smoke. 2 30 B2 Smoke started to escape from the unexposed side. 3 05 A/B Smoke started to escape from the vertical joint between the two modules. 3 30 C1 Smoke started to escape from the bottom of the panel. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 4 55 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to seep between the glazing layers. 7 45 A3 Flames started to spread across the bottom of the glazing. 8 18 A1 The face had opened up. 8 18 A1 The face had opened up. 8 42 A2/A3 The flaming in the area had increased in intensity. 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 42 A3 The glazing layers started to open up. 10 28 B1 The bottom of the panel flamed independently. 10 28 B1 Th | 1 | 02 | A2 | More of the panel face had discoloured. | |
| 1 50 A3 The bottom of the glazing started to smoke. 2 30 B2 Smoke started to escape from the unexposed side. 3 05 A/B Smoke started to escape from the vertical joint between the two modules. 3 30 C1 Smoke started to escape from the bottom of the panel. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 5 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to seep between the glazing layers. 7 45 A3 Flames started to spread across the bottom of the glazing. 8 18 A1 The face had opened up. 8 42 A2/A3 The flaming in the area had increased in intensity. 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 42 A3 The glazing layers started to open up. 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel flamed independently. 11 41 A3 The glazing started by crack and shatter off. 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames shad breached into the back of the panel. 25 B2 The flames started to breach on to the unexposed side of the specimen. 26 27 B2 The flames started to melt off. 27 B3 B1 The panel face started to melt off. 28 B1 The panel face started to melt off. 29 A3 The flames had breached on the unexposed side of the specimen. 29 A3 The flames had breached on the unexposed side of the specimen. 29 A3 The flames had breached on the unexposed side of the specimen. 20 A3/AB The flames had breached on the unexposed side of the specimen. | 1 | 13 | A3 | The flames had reached the bottom of the glazing. | |
| 2 30 B2 Smoke started to escape from the unexposed side. 3 05 A/B Smoke started to escape from the vertical joint between the two modules. 3 30 C1 Smoke started to escape from the bottom of the panel. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 4 55 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to seep between the glazing layers. 7 45 A3 Flames started to spread across the bottom of the glazing. 8 18 A1 The face had opened up. 8 42 A2/A3 The flaming in the area had increased in intensity. 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 42 A3 The glazing layers started to open up. 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel flamed independently. 10 28 B1 The bottom of the panel flamed independen | 1 | 25 | A2 | The flames started to spread laterally across to B2. | |
| 3 05 A/B Smoke started to escape from the vertical joint between the two modules. 3 30 C1 Smoke started to escape from the bottom of the panel. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 4 55 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to seep between the glazing layers. 7 45 A3 Flames started to spread across the bottom of the glazing. 8 18 A1 The face had opened up. 8 42 A2/A3 The flaming in the area had increased in intensity. 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 42 A3 The glazing layers started to open up. 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel flamed independently. 10 34 C1/C2 Flames started spreading across the panel to panel joint. 11 41 A3 The glazing started to reach | 1 | 50 | A3 | The bottom of the glazing started to smoke. | |
| 3 30 C1 Smoke started to escape from the bottom of the panel. 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 5 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to seep between the glazing layers. 7 45 A3 Flames started to spread across the bottom of the glazing. 8 18 A1 The face had opened up. 8 42 A2/A3 The flaming in the area had increased in intensity. 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 42 A3 The glazing layers started to open up. 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel flamed independently. 11 A3 The glazing started spreading across the panel to panel joint. 11 41 A3 The glazing started to crack and shatter off. 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 25 B2 The panel face started and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 15 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side of the specimen. 25 B2 The flames started to breach on the unexposed side of the specimen. 26 27 B2 The flames had breached to the unexposed side of the specimen. 27 A1/A2 Flames started to breach on the unexposed side of the specimen. 28 B1 The panel face started to melt off. 29 B2 The flames had breached to the face of the panel. 20 B2 Smoke started to escape from the top of the vertical joint between the modules. | 2 | 30 | B2 | Smoke started to escape from the unexposed side. | |
| 4 19 A1/A2 Molten debris started to drip, with portions of it flaming. 4 55 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to seep between the glazing layers. 7 45 A3 Flames started to spread across the bottom of the glazing. 8 18 A1 The face had opened up. 8 42 A2/A3 The flaming in the area had increased in intensity. 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 42 A3 The glazing layers started to open up. 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel flamed independently. 10 34 C1/C2 Flames started spreading across the panel to panel joint. 11 41 A3 The glazing started to crack and shatter off. 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 25 B2 The panel face started to open up. 17 A3 More glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 22 A3 The flames had breached on the unexposed side of the specimen. 23 B1 The panel face started to melt off. 24 58 B1 The panel face started to melt off. 25 C3 B2 The flames had breached on the unexposed side. | 3 | 05 | A/B | Smoke started to escape from the vertical joint between the two modules. | |
| 4 55 B2 The panel face had discoloured. 5 30 A3 The bottom of the panel had flamed independently. 6 02 A3 Smoke started to seep between the glazing layers. 7 45 A3 Flames started to spread across the bottom of the glazing. 8 18 A1 The face had opened up. 8 42 A2/A3 The flaming in the area had increased in intensity. 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 42 A3 The glazing layers started to open up. 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel flamed independently. 10 34 C1/C2 Flames started spreading across the panel to panel joint. 11 41 A3 The glazing started to crack and shatter off. 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 26 B1 The panel face started to melt off. 27 B2 B6 The flames had breached on the unexposed side. 28 B1 The panel face started to melt off. 29 B2 The flames had breached on the unexposed side. 20 B1 The panel face started to melt off. 21 Sa B2 The flames had breached the face of the panel. 22 Sa B2 The flames had breached the face of the panel. | 3 | 30 | C1 | Smoke started to escape from the bottom of the panel. | |
| 530A3The bottom of the panel had flamed independently.602A3Smoke started to seep between the glazing layers.745A3Flames started to spread across the bottom of the glazing.818A1The face had opened up.842A2/A3The flaming in the area had increased in intensity.846A2The panel face opened up, with a gas burst occurring as well.942A3The glazing layers started to open up.950B1The bottom of the panel started to open up.1028B1The bottom of the panel flamed independently.1034C1/C2Flames started spreading across the panel to panel joint.1141A3The glazing started to crack and shatter off.1440A1/A2The panel face collapsed off the specimen.1526A/BFlames started escaping from the top of the vertical joint between the modules.1625B2The panel face started to open up.1659A3Some glazing shattered and fell on the unexposed side.1810A3More glazing shattered and fell on the unexposed side.1833A/BThe flaming from the top of the vertical joint had stopped.1855B2The flames had breached into the back of the panel.2115A1/A2Flames started to breach on the unexposed side of the specimen.2425A3The flames had breached on the unexposed side.25< | 4 | 19 | A1/A2 | Molten debris started to drip, with portions of it flaming. | |
| 602A3Smoke started to seep between the glazing layers.745A3Flames started to spread across the bottom of the glazing.818A1The face had opened up.842A2/A3The flaming in the area had increased in intensity.846A2The panel face opened up, with a gas burst occurring as well.942A3The glazing layers started to open up.950B1The bottom of the panel started to open up.1028B1The bottom of the panel flamed independently.1034C1/C2Flames started spreading across the panel to panel joint.1141A3The glazing started to crack and shatter off.1440A1/A2The panel face collapsed off the specimen.1526A/BFlames started escaping from the top of the vertical joint between the modules.1625B2The panel face started to open up.1659A3Some glazing shattered and fell on the unexposed side.1810A3More glazing shattered and fell on the unexposed side.1833A/BThe flaming from the top of the vertical joint had stopped.1855B2The flames had breached into the back of the panel.2115A1/A2Flames started to breach on to the unexposed side of the specimen.2425A3The flames had breached on the unexposed side.2523B2The flames had breached the face of the panel.26 | 4 | 55 | B2 | The panel face had discoloured. | |
| Flames started to spread across the bottom of the glazing. Results A1 | 5 | 30 | A3 | The bottom of the panel had flamed independently. | |
| 8 | 6 | 02 | A3 | Smoke started to seep between the glazing layers. | |
| 842A2/A3The flaming in the area had increased in intensity.846A2The panel face opened up, with a gas burst occurring as well.942A3The glazing layers started to open up.950B1The bottom of the panel started to open up.1028B1The bottom of the panel flamed independently.1034C1/C2Flames started spreading across the panel to panel joint.1141A3The glazing started to crack and shatter off.1440A1/A2The panel face collapsed off the specimen.1526A/BFlames started escaping from the top of the vertical joint between the modules.1625B2The panel face started to open up.1659A3Some glazing shattered and fell on the unexposed side.1810A3More glazing shattered and fell on the unexposed side.1833A/BThe flaming from the top of the vertical joint had stopped.1855B2The flames had breached into the back of the panel.2115A1/A2Flames started to breach on to the unexposed side of the specimen.2425A3The flames had breached on the unexposed side.2523B2The flames had breached the face of the panel.2623B/CSmoke started to escape from the top of the vertical joint between the modules. | 7 | 45 | A3 | Flames started to spread across the bottom of the glazing. | |
| 8 46 A2 The panel face opened up, with a gas burst occurring as well. 9 42 A3 The glazing layers started to open up. 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel flamed independently. 10 34 C1/C2 Flames started spreading across the panel to panel joint. 11 41 A3 The glazing started to crack and shatter off. 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 25 B2 The panel face started to open up. 18 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 25 B1 The panel face started to melt off. 26 27 B2 The flames had breached the face of the panel. 27 Smoke started to escape from the top of the vertical joint between the modules. | 8 | 18 | A1 | The face had opened up. | |
| 9 42 A3 The glazing layers started to open up. 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel flamed independently. 10 34 C1/C2 Flames started spreading across the panel to panel joint. 11 41 A3 The glazing started to crack and shatter off. 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 25 B2 The panel face started to open up. 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 25 B1 The panel face started to melt off. 26 27 B2 The flames had breached the face of the panel. 27 Smoke started to escape from the top of the vertical joint between the modules. | 8 | 42 | A2/A3 | The flaming in the area had increased in intensity. | |
| 9 50 B1 The bottom of the panel started to open up. 10 28 B1 The bottom of the panel flamed independently. 10 34 C1/C2 Flames started spreading across the panel to panel joint. 11 41 A3 The glazing started to crack and shatter off. 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 25 B2 The panel face started to open up. 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 25 B1 The panel face started to melt off. 26 27 B2 The flames had breached the face of the panel. 27 Smoke started to escape from the top of the vertical joint between the modules. | 8 | 46 | A2 | The panel face opened up, with a gas burst occurring as well. | |
| 10 28 B1 The bottom of the panel flamed independently. 10 34 C1/C2 Flames started spreading across the panel to panel joint. 11 41 A3 The glazing started to crack and shatter off. 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 25 B2 The panel face started to open up. 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 25 B1 The panel face started to melt off. 26 27 B2 Smoke started to escape from the top of the vertical joint between the modules. | 9 | 42 | A3 | The glazing layers started to open up. | |
| 10 34 C1/C2 Flames started spreading across the panel to panel joint. 11 41 A3 The glazing started to crack and shatter off. 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 25 B2 The panel face started to open up. 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 25 B1 The panel face started to melt off. 26 27 B2 The flames had breached the face of the panel. 27 Smoke started to escape from the top of the vertical joint between the modules. | 9 | 50 | B1 | The bottom of the panel started to open up. | |
| 11 | 10 | 28 | B1 | The bottom of the panel flamed independently. | |
| 14 40 A1/A2 The panel face collapsed off the specimen. 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 25 B2 The panel face started to open up. 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 25 B1 The panel face started to melt off. 26 27 B2 The flames had breached the face of the panel. 27 Smoke started to escape from the top of the vertical joint between the modules. | 10 | 34 | C1/C2 | Flames started spreading across the panel to panel joint. | |
| 15 26 A/B Flames started escaping from the top of the vertical joint between the modules. 16 25 B2 The panel face started to open up. 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 25 B1 The panel face started to melt off. 26 27 B2 Smoke started to escape from the top of the vertical joint between the modules. | 11 | 41 | A3 | The glazing started to crack and shatter off. | |
| 16 25 B2 The panel face started to open up. 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 24 58 B1 The panel face started to melt off. 25 23 B2 The flames had breached the face of the panel. 26 27 B/C Smoke started to escape from the top of the vertical joint between the modules. | 14 | 40 | A1/A2 | The panel face collapsed off the specimen. | |
| 16 59 A3 Some glazing shattered and fell on the unexposed side. 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 24 58 B1 The panel face started to melt off. 25 23 B2 The flames had breached the face of the panel. 26 27 B/C Smoke started to escape from the top of the vertical joint between the modules. | 15 | 26 | A/B | Flames started escaping from the top of the vertical joint between the modules. | |
| 18 10 A3 More glazing shattered and fell on the unexposed side. 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 24 58 B1 The panel face started to melt off. 25 23 B2 The flames had breached the face of the panel. 26 27 B/C Smoke started to escape from the top of the vertical joint between the modules. | 16 | 25 | B2 | The panel face started to open up. | |
| 18 33 A/B The flaming from the top of the vertical joint had stopped. 18 55 B2 The flames had breached into the back of the panel. 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 24 58 B1 The panel face started to melt off. 25 23 B2 The flames had breached the face of the panel. 26 27 B/C Smoke started to escape from the top of the vertical joint between the modules. | 16 | 59 | A3 | Some glazing shattered and fell on the unexposed side. | |
| The flames had breached into the back of the panel. 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 16 A3 The flames had breached on the unexposed side. 17 A3 The flames had breached on the unexposed side. 18 B1 The panel face started to melt off. 18 B2 The flames had breached the face of the panel. 18 B2 The flames had breached the face of the panel. 18 B2 Smoke started to escape from the top of the vertical joint between the modules. | 18 | 10 | A3 | More glazing shattered and fell on the unexposed side. | |
| 21 15 A1/A2 Flames started to breach on to the unexposed side of the specimen. 24 25 A3 The flames had breached on the unexposed side. 24 58 B1 The panel face started to melt off. 25 23 B2 The flames had breached the face of the panel. 26 27 B/C Smoke started to escape from the top of the vertical joint between the modules. | 18 | 33 | A/B | The flaming from the top of the vertical joint had stopped. | |
| 24 25 A3 The flames had breached on the unexposed side. 24 58 B1 The panel face started to melt off. 25 23 B2 The flames had breached the face of the panel. 26 23 B/C Smoke started to escape from the top of the vertical joint between the modules. | 18 | 55 | B2 | The flames had breached into the back of the panel. | |
| 2458B1The panel face started to melt off.2523B2The flames had breached the face of the panel.2623B/CSmoke started to escape from the top of the vertical joint between the modules. | 21 | 15 | A1/A2 | Flames started to breach on to the unexposed side of the specimen. | |
| 25 23 B2 The flames had breached the face of the panel. 26 23 B/C Smoke started to escape from the top of the vertical joint between the modules. | 24 | 25 | A3 | The flames had breached on the unexposed side. | |
| 26 23 B/C Smoke started to escape from the top of the vertical joint between the modules. | 24 | 58 | B1 | The panel face started to melt off. | |
| | 25 | 23 | B2 | The flames had breached the face of the panel. | |
| 27 55 C1/C2 Smoke started escaping from the panel to panel joint. | 26 | 23 | B/C | Smoke started to escape from the top of the vertical joint between the modules. | |
| | 27 | 55 | C1/C2 | Smoke started escaping from the panel to panel joint. | |



| Time | | System | Observation |
|------|-----|--------|--|
| Min | Sec | | |
| 29 | 15 | C2 | The panel face started to melt off. |
| 30 | 00 | - | The burner was turned off. |
| 30 | 16 | A3 | A large chunk of the glazing fell on to exposed side. |
| 31 | 10 | B1/B2 | The panels were still flaming internally. |
| 31 | 10 | A1/A2 | The panel has completely come off the module. |
| 31 | 31 | A3 | More glazing shards shattered off. |
| 31 | 43 | B3 | The glazing had shattered and some pieces fell of the specimen. |
| 32 | 53 | C2/B2 | Flames started to escape from the panel to panel joint. |
| 33 | 42 | B3 | More glass shattered off the specimen. |
| 36 | 31 | C1/C2 | The panel joint was flaming independently. |
| 38 | 05 | B1 | The flaming panel fell off the specimen. |
| 39 | 00 | B1/B2 | Most of the panel had detached from the specimen, with the pieces remaining still flaming. |
| 42 | 45 | C2 | All the flaming on the panel had ceased. |
| 45 | 00 | C1 | All the flaming on the panel had ceased. |
| 56 | 45 | Floor | All the flaming debris on the floor had ceased flaming. |
| 60 | 00 | - | The reaction to fire test was ended. |

Revision: R3.0 Page 19 of 45



5. **Application of test results**

5.1 **Test limitations**

The results of these fire tests may be used to directly assess fire hazard, but it should be recognised that a single test method will not provide a full assessment of fire hazard under all fire conditions.

These results only relate to the behaviour of the specimen of the element of construction under the particular conditions of the test. They are not intended to be the sole criteria for assessing the potential fire performance of the element in use, and they do not necessarily reflect the actual behaviour in fires.

5.2 Variations from the tested specimen

This report details methods of construction, the test conditions and the results obtained when the specific element of construction described here was tested following the procedure outlined in Table 3. Any significant variation with respect to size, construction details, loads, stresses, edge or end conditions is not addressed by this report.

It is recommended that any proposed variation to the tested configuration should be referred to the test sponsor. They should then obtain appropriate documentary evidence of compliance from Warringtonfire or another accredited testing authority.

Uncertainty of measurements 5.3

Because of the nature of reaction to fire testing and the consequent difficulty in quantifying the uncertainty of measurements obtained from a reaction to fire test, it is not possible to provide a stated degree of accuracy of result.

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140

Revision: R3.0 Test sponsor: Cladding Safety Victoria (CSV) Page 20 of 45



Appendix A Drawings of test assembly

The drawings of the test assembly in Figure 13 to Figure 27 were provided by the representatives of Warringtonfire. Dimensions, unless specified, are in mm.

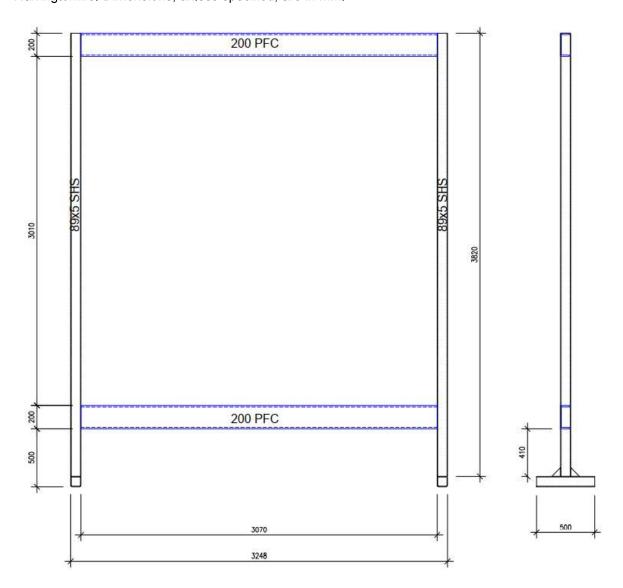


Figure 13 Elevation of rig support



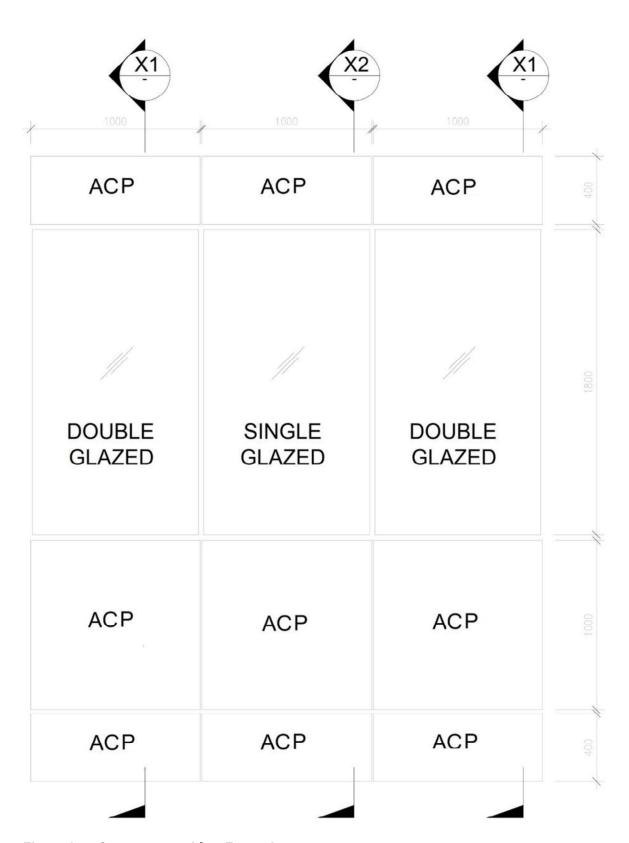


Figure 14 System assembly – Front view

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



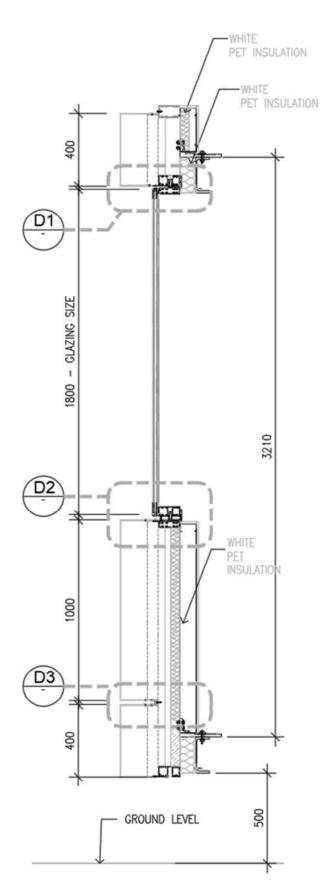


Figure 15 System assembly – vertical cross-sectional view X1

Test standard: General accordance with ISO 13785-1:2002



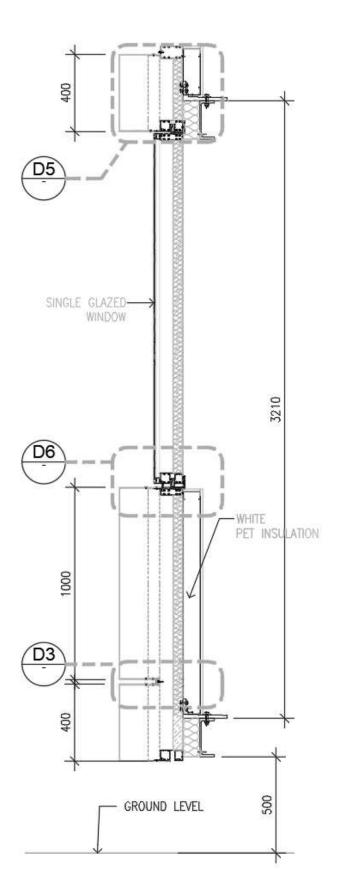


Figure 16 System assembly – vertical cross-sectional view X2

Test standard: General accordance with ISO 13785-1:2002



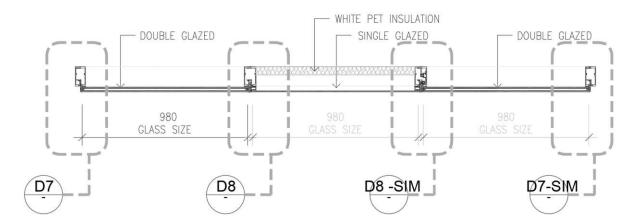


Figure 17 System assembly – horizontal mid height cross-sectional view

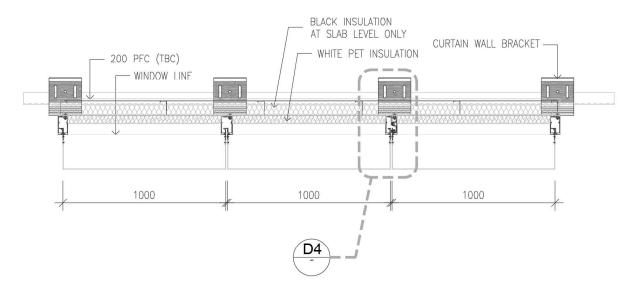


Figure 18 System assembly -top view

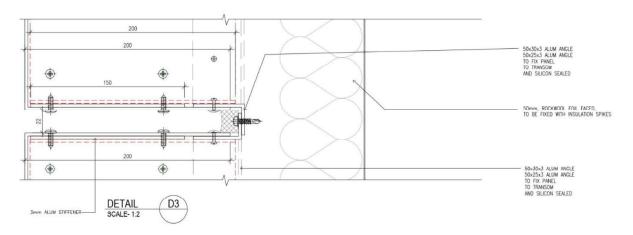


Figure 19 System assembly – Vertical cross-sectional view D3

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



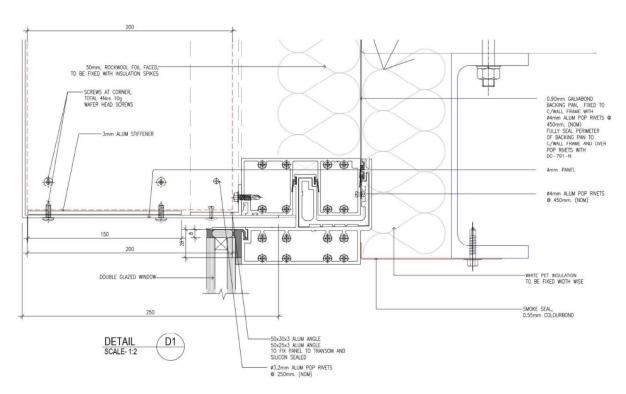


Figure 20 System assembly - Vertical cross-sectional view D1

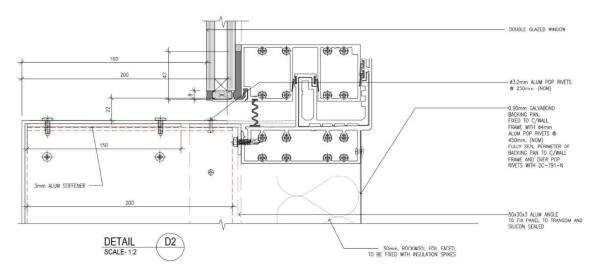


Figure 21 System assembly – Vertical cross-sectional view D2

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



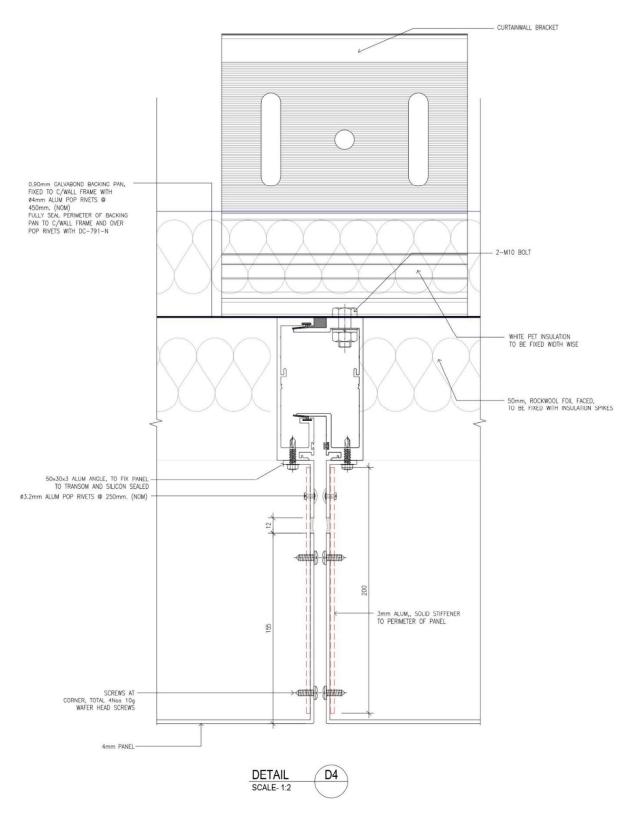


Figure 22 System assembly - Horizontal cross-sectional view D4

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140



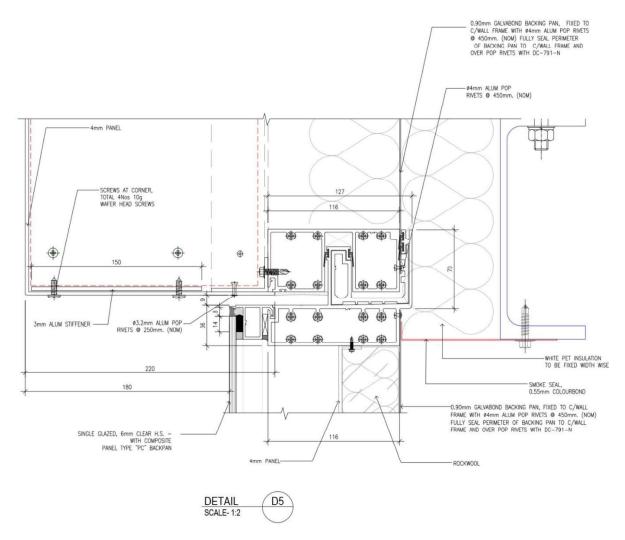


Figure 23 System assembly - Vertical cross-sectional view D5

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



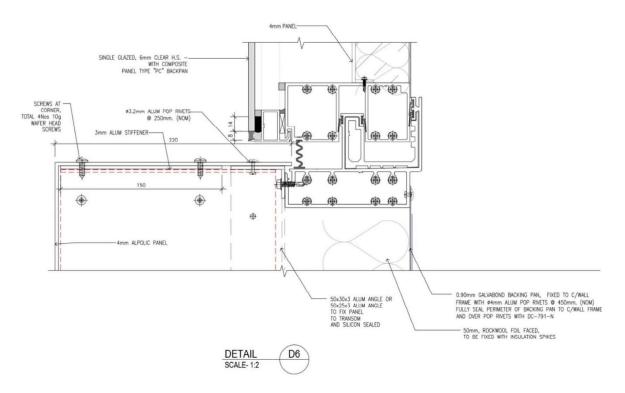


Figure 24 System assembly - Vertical cross-sectional view D6

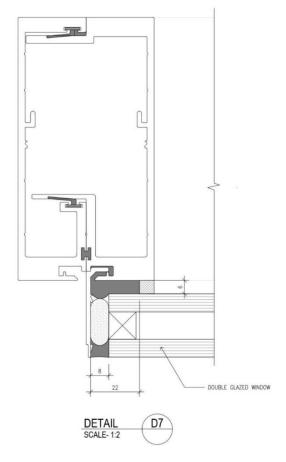


Figure 25 System assembly – vertical cross-sectional view D7

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140



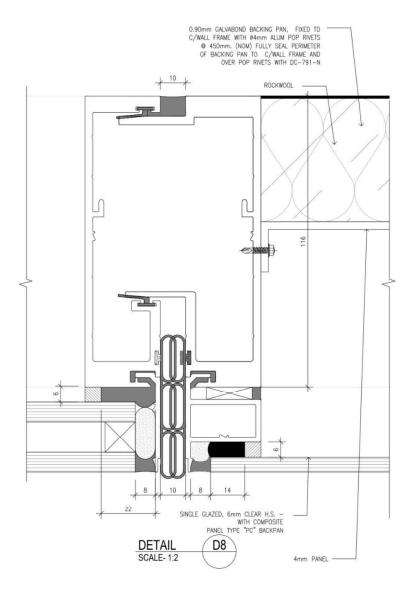


Figure 26 System assembly - vertical cross-sectional view D8

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



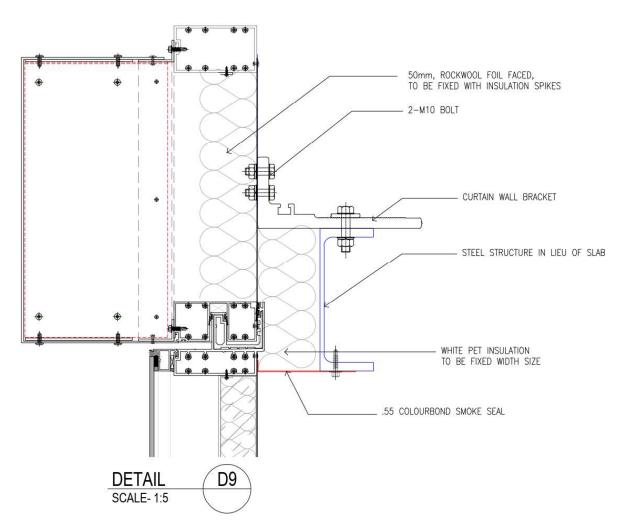


Figure 27 System assembly - vertical cross-sectional view D9



Appendix B Photographs



Figure 28 The specimen (exposed side) before the reaction to fire test



Figure 29 The specimen (unexposed side) before the reaction to fire test

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140



Figure 30 The specimen 1 minute 21 seconds into the test (burner output at 300 kW)



Figure 31 The specimen 5 minutes into the test (burner output at 300 kW)

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140





Figure 32 The specimen 8 minutes 13 seconds into the test (burner output at 300 kW)



Figure 33 The specimen 10 minutes 5 seconds into the test (burner output at 300 kW)

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140



Figure 34 The specimen 12 minutes 16 seconds into the test (burner output at 300 kW)



Figure 35 The specimen 14 minutes 32 seconds into the test (burner output at 300 kW)

Test standard: General accordance with ISO 13785-1:2002



The specimen 18 minutes into the test (burner output at 300 kW) Figure 36



Figure 37 The specimen 22 minutes into the test (burner output at 300 kW)

Test standard: General accordance with ISO 13785-1:2002



Z5:DB

Figure 38 The specimen 25 minutes 8 seconds into the test (burner output at 300 kW)



Figure 39 The specimen 28 minutes into the test (burner output at 300 kW)

Test standard: General accordance with ISO 13785-1:2002





Figure 40 The specimen 30 minutes into the test (burner output at 300 kW)



Figure 41 The specimen 30 minutes 10 seconds into the test (burner off)

Test standard: General accordance with ISO 13785-1:2002





Figure 42 The specimen 40 minutes into the test (burner off)



Figure 43 The specimen 52 minutes 5 seconds into the test (burner off)

Test standard: General accordance with ISO 13785-1:2002





The specimen at end of test - exposed side Figure 44



Figure 45 The specimen at end of test - unexposed side



Appendix C Chemical analysis results



UNSW RESEARCH INFRASTRUCTURE

Chemical Consulting Laboratory

Mark Wainwright Analytical Centre UNSW Sydney NSW 2052 Australia

T: +61(2) 9348 1400 | E: <u>col@unsw.edu.au</u>
W: <u>www.analytical.unsw.edu.au/contact-us/commercial-consulting</u>
ABN 57 195 873 179 | CRICOS Provider Code 00098G

Test Report

Prepared by:

ANALYSIS OF CLADDING SAMPLES

For

Company: Warrington Fire

Date: 22 February 2024

Project No: 24021

Contact:

Prepared by: Approved by:



000

COMMERCIAL-IN-CONFIDENCE

Any use of the Test Report, use of any part of it, use of the names University of New South Wales or UNSW, use of the name of any Unit of UNSW, or use of the name of the consultant in direct or indirect advertising or publicity is strictly forbidden.

Project No.: 24021

Chemical Consulting Laboratory - UNSW

Page 1 of 7

This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140

Test sponsor: Cladding Safety Victoria (CSV)

Revision: R3.0 Page 41 of 45





Analysis of Cladding Samples

1. SAMPLES

One envelope containing three ACP cores was received for analysis. The samples were identified as follows:

| CCL sample coding | Client sample coding |
|-------------------|----------------------|
| 24021-1 | #1 - 100% |
| 24021-2 | #2 - 100% |

CCL has been asked to identify the polymer and the filler (s) in the samples by FT/IR, quantitate and identify the mineral filler in the samples and classify them in accordance with the ICA cladding scheme.

2. METHODOLOGY AND RESULTS

The aluminium metals were removed from the ACPs cladding polymer, and the flat surface of the polymer sample was abraded to remove any surface adhesive. The surface of the sample was analysed directly by FTIR. The FT-IR spectra are presented in Figures 1-3.

The core of the samples was then ashed to determine their percentage mineral content (Table 1). If sufficient (>0.5 g) ash was found in the sample, it was analysed for elemental composition by X ray fluorescence spectroscopy. Results are presented in Table 2.

Table 1 Ash content of 24021-1-3

| Sample coding | Ash content (w/w%) |
|---------------|--------------------|
| 24021-1 | 3.3 |
| 24021-2 | 3.0 |

Project No.: 24021

Chemical Consulting Laboratory - UNSW

Page 2 of 7

This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140 Test sponsor: Cladding Safety Victoria (CSV)

Revision: R3.0 Page 42 of 45



3. CONCLUSIONS

The cladding sample #1 consisted of 3.3% inert material and approximately 96% polyethylene polymer.

The cladding sample #1 is classified as ICA category A.

The cladding sample #2 consisted of 3.0% inert material and approximately 97% polyethylene polymer.

The cladding sample #2 is classified as ICA category A.

The ICA Classification assigned is correct as per the September 2020 revision of the ICA Guidelines.

The reader is reminded that we can only analyse and classify the content of samples actually presented to us. We can offer no guarantee that this composition or classification is valid for cladding as a whole, because some types of cladding can be inhomogeneous, and a sample may not be representative of the cladding as a whole. Anyone using our results should consider these sampling issues and uncertainties before they generalise the results we present to anybody of cladding as a whole.

Dominic D'adam BSc/BE (Hons)
Senior Technical Officer
Chemical Consulting Laboratory
Mark Wainwright Analytical Centre, UNSW
22 February 2024



Project No.: 24021


Chemical Consulting Laboratory - UNSW

Page 4 of 7


This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



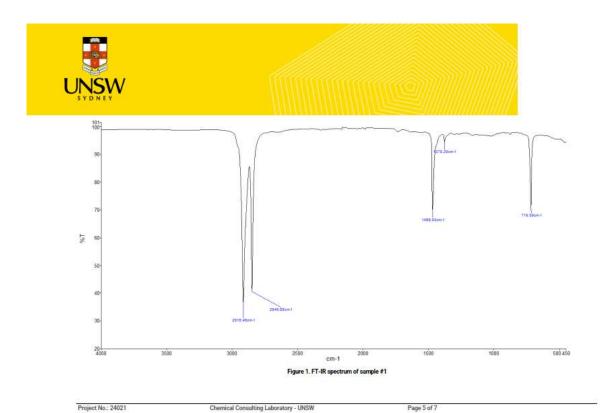

This report shall not be reproduced, except in full, without written approval of the CCL

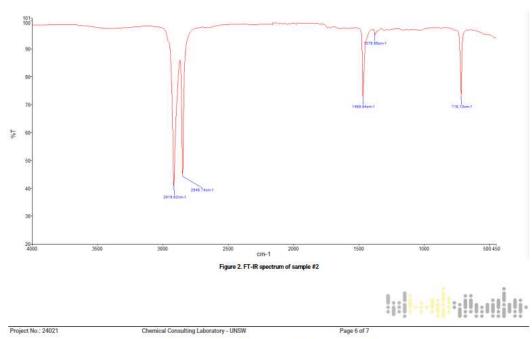

This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140 Test sponsor: Cladding Safety Victoria (CSV) Revision: R3.0 Page 44 of 45



Warringtonfire Australia Pty Ltd ABN 81 050 241 524

Perth

Suite 4.01, 256 Adelaide Terrace Perth WA 6000 Australia T: +61 8 9382 3844

Sydney

Suite 802, Level 8, 383 Kent Street Sydney NSW 2000 Australia T: +61 2 9211 4333

General conditions of use

Canberra

Unit 10, 71 Leichhardt Street Kingston ACT 2604 Australia T: +61 2 6260 8488

Brisbane

Suite B, Level 6, 133 Mary Street Brisbane Qld 4000 Australia T: +61 7 3238 1700 Melbourne

Level 4, 152 Elizabeth Street Melbourne Vic 3000 Australia T: +61 3 9767 1000

Melbourne - NATA accredited laboratory

409-411 Hammond Road Dandenong South Vic 3175 Australia T: +61 3 9767 1000

The data, methodologies, calculations and results documented in this report specifically relate to the tested specimen/s and must not be used for any other purpose. This report may only be reproduced in full. Extracts or abridgements must not be published without permission from Warringtonfire.

All work and services carried out by Warringtonfire are subject to, and conducted in accordance with our standard terms and conditions. These are available on request.