



Reaction to fire test report

Test standard: Ad-hoc test based off ISO 13785-1:2002

Test sponsor: Cladding Safety Victoria (CSV)

System: Aluminium composite panel (ACP) and glazing external wall cladding system

Job number: RTF230140

Test date: 27 March 2024 Revision: R2.0



Quality management

Revision	Date	Information abo	out the report		
R2.0	31 May 2024	Description	Initial issue.		
			Prepared by	Reviewed by	Authorised by
		Name			
		Signature			
	fire* Acceptable Dt				

Warringtonfire* Australia Pty Ltd ABN 81 050 241 524

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140

Revision: R2.0 Test sponsor: Cladding Safety Victoria (CSV) Page 2 of 43

^{*}As used herein, The name "Warringtonfire" and its associated IP and branding is used by Warringtonfire Australia Pty Limited in Australia under licence from Warringtonfire Testing and Certification Limited (based in the UK) for a transitional period following the acquisition of Warringtonfire Australia Pty Limited. The Warringtonfire Testing and Certification Limited continues to own the rights to "Warringtonfire" and continues to operate the global "Warringtonfire business" outside of Australia.



Contents

1.	Introduction	on	4
2.	Test spec	imen	4
2.1	Schedule of	components	4
3.	Test proce	edure	9
4.	Test meas	surements and results	10
5.	Applicatio	n of test results	18
5.1 5.2 5.3	Test limitation Variations fr Uncertainty	onsom the tested specimenof measurements	18 18
Appe	ndix A	Drawings of test assembly	19
Appe	ndix B	Photographs	30
Appe	ndix C	Chemical Analysis Results	43



1. Introduction

This report documents the findings of test two of three ad-hoc reaction to fire tests for an Aluminium composite panel (ACP) and glazing external wall cladding system performed on 27 March 2024. The test was based off some general requirements of ISO 13785-1:2002.

Warringtonfire performed the test at the request of the test sponsor listed in Table 1.

Table 1 Test sponsor details

Test sponsor	Address
Cladding Safety Victoria (CSV)	717 Bourke Street Docklands, VIC 3808
	Australia

2. Test specimen

2.1 Schedule of components

Table 2 describes the test specimen and lists the schedule of components. These were provided by the representatives of the test sponsor and surveyed by Warringtonfire. All measurements were done by Warringtonfire – unless indicated otherwise.

Detailed drawings of the test specimen are provided in Appendix A.

Table 2 Schedule of components

Item	Description		
Clado	ding		
1.	Item name	Aluminium composite panel (ACP) panel	
	Product	Aluminium Composite Panel - 4 mm Whi	te Gloss/Grey
	Manufacturer/Supplier		
	Note on Supply of Panel	On behalf of CSV, Warringtonfire acquire core. To the best of Warringtonfire's know which the supplier doesn't normally supp basis that this was for research purposes testing.	wledge this is a custom production ly. The panels were provided on the
	Material	The material was nominated as panels c sheets sandwiching a layer (core) with 10	
		Analysis conducted by the analytical cen consisted of polyethylene (PE) - found to of the material was found to be 3.3 % ine	be 96 % w/w - whilst the remainder
		Refer to Appendix C for more detailed re	sults.
	Colour	Skins	Front skin – Gloss white Back skin – Light grey
		Core	Black
	Size	Total panel thickness – 4.0 mm Skin thickness – 0.5 mm (both) Uncut: 4.0 m × 1.22 m Refer to Appendix A for individual panel s	sizing details.
	Batch		
	Areal density	5.6 kg/m² (measured)	

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140



Item	Description	
2.	Item name	Back-pan
	Product	Nominally 0.9 mm thick Galvabond sheet, measured 0.6 mm
	Supplier	
	Material	Galvanised steel
	Batch	
	Size	1160 mm wide × 3700 mm tall, 0.6 mm thick – in segments.
Glazi	ng	
3.	Item name	Double glazing
	Material	6 mm Clear Heat Strengthened\12B (Argon filled cavity) \6.5 HU
	Size (nominal)	1188 mm wide × 1800 mm tall × 6 mm/12 mm/6.5 mm with a 12 mm black spacer.
	Manufacturer/Supplier	
	Batch	
4.	Item name	Single glazing
	Material	6 mm Clear Heat Strengthened
	Size (nominal)	1182 mm wide × 1800 mm tall × 6 mm thick
	Manufacturer/Supplier	
	Batch	
Fram	ing	
5.	Item name	Test rig frame - 90 × 90 SHS and 200 × 90 PFC frame
	Material	Painted steel
	Size	90 mm × 90 mm × 5 mm thick and 200 mm × 90 mm × 10 mm thick – refer to Figure 12.
6.	Item name	Aluminium curtain wall transom/mullions (rectangular hollow sections) – framing
	Material	Aluminium
	Size	65 mm to 70 mm wide × 116 mm deep × 3 mm thick.
	Manufacturer/Supplier	
7.	Item name	Aluminium angles - framing
	Size	25 mm wide × 50 mm deep × 3 mm thick
	Material	Aluminium
	Manufacturer/Supplier	
8.	Item name	Aluminium angles – for middle double back-pan unit.
	Size	25 mm wide × 50 mm deep × 3 mm thick
	Material	Aluminium
	Manufacturer/Supplier	
	Installation	Used to secure the secondary back-pan within the middle module. The angle was screw fixed to both the back-pan (item 1) and the aluminium framing (item 6) using screws (item 18).



Item	Description	
9.	Item name	Aluminium stiffener - framing
	Size	3 mm thick × 150 mm deep
	Material	Aluminium
	Manufacturer/Supplier	
10.	Item name	Curtain wall bracket
10.	Size	150 mm deep (7 mm thick) × 75 tall (10 mm thick) × 100 mm wide
	Installation	Used to secure the 3 modules to the test rig using tek screws.
Cm al	ke seal	Osed to secure the 3 modules to the testing daing tex screws.
	T	Ometer and
11.	Item name	Smoke seal
	Size	0.55 mm thick galvanised steel
	Manufacturer/Supplier	
	tration 	
12.	Item name	Exhaust
	Size	Backing plates: 355 mm × 355 mm × 0.6 mm thick
		Large tube: Ø150 mm × 600 mm long × 0.5 mm thick Cap: Ø240 mm × 85 mm deep × 0.6 mm thick
		Connecting strips: 45 mm × 5 mm wide × 0.5 mm thick
	Material	Galvanised steel
	Manufacturer/Supplier	
	Pictures	
		Exposed side Unexposed side
	Installation	The penetrating element was a galvanised steel tube. On the glazing side was a circular weather cowl. A square compartment made from galvanised steel which hid the tubing was installed between the glazing and the inner backpan.
Insul	ation	
13.	Item name	90 mm thick polyethylene terephthalate (PET) insulation
	Density	10 kg/m³
	Manufacturer/Supplier	
14.	Item name	50 mm thick aluminium - with fibre-glass mesh - foil faced rockwool insulation
	Density of core	40 kg/m ³
	Manufacturer/Supplier	
Seala	ınt/Adhesive	-
15.	Item name	Weathering sealant - silicone sealant
	Product name	



Item	Description	
	Manufacturer/Supplier	
	Usage	Placed at ACP edges and screw and rivet locations.
16.	Item name	Back-pan sealant - Fire-rated mastic
	Product name	
	Manufacturer/Supplier	
	Usage	Used between the back-pans (item 1) and the aluminium framing (item 7).
17.	Item name	Penetration sealant
	Product name	
	Manufacturer/Supplier	
	Usage	Used between the back-pans (item 1) and the aluminium framing (item 7).
Fixin	gs	
18.	Item name	Tek screws SDS – zinc coated steel – for fixing the back-pan
	Size	10g × 24 mm long
	Installation	Used to fix aluminium angles (item 8) to the aluminium frame (item 6) at max. 500 mm centres
19.	Item name	Wafer head screws – zinc coated steel
	Size	10g × 16 mm long
	Installation	Used to fix aluminium angles (item 8) to the aluminium frame (item 6) at max. 500 mm centres
20.	Item name	Wafer head screws – zinc coated steel
	Size	10g × 20 mm long
	Installation	Used to fix the penetration backing plate (item 12) to the back-pan (item 2) of the central module.
21.	Item name	Wafer head screws – zinc coated steel
	Size	10g × 21 mm long
	Installation	Used to fix ACP (item1) to the aluminium stiffener (item 9) – four per corner.
22.	Item name	Aluminium rivets
	Size	Ø4 mm
23.	Item name	Fast-fix washers and pin weld (to hold insulation)
	Size	115 mm × 3 mm pins and 25 mm × 25 mm fast fix washers.
24.	Item name	Tek screws for curtain wall bracket
	Size	14 g × 35 mm long
25.	Item name	Tek screws for smoke seal to false slab i.e. C-Purlin
	Size	14 g × 35 mm long
Insta	llation method	
Test r	ig:	The test rig frame (item 5) was the main support for the test specimen, however, there were two C-purlin sections that acted as false slabs (200 mm tall). The test specimen, 3-off modules – interconnected through aluminium framing (item 6), was fixed to the test rig using curtain wall brackets (item 10) and fixings (item 24) – see Figure 14 & Figure 16. Each module extended from the bottom of the specimen to the top.



Item Description	
Framing:	The main framing for the external wall was composed of aluminium extrusions (item 6) which were screw fixed together. Aluminium angles (item 8) – horizontal edges - and stiffeners (item 9) – on the vertical edges - were fixed to the aluminium framing (item 6), using wafer head screws (item 20) and aluminium rivets (item 22), respectively.
Cladding:	The front face of the specimen was cladded with cassetted ACPs (item1), which were fixed to the aluminium stiffeners (item 9) and the aluminium angles (item 8) using aluminium rivets (item 22), 2-off at 300 mm centres. See Figure 13 for panel locations.
	The back side of the framing was closed off with steel back-pans (item 1) screw fixed (item 18) at 300 mm centres. PET insulation (item 13) was fixed to the back-pan using fast-fix washers and pin combinations (item 19) that were welded to the back-pan. The centre module had an extra back-pan behind the glazing (item 4). This was fixed to the aluminium framing (item 6) using screws (item 18) and aluminium angles (item 8). Foil-faced rockwool insulation (item 14) was inserted between the two back-pans (item 1) of the centre module.
Glazing	The glazing, both double (item 3) and single (item 4), were attached to the aluminium framing (item 6) as shown in Figure 13 to Figure 23 and Figure 26. The glazing was sealed around the perimeter with weather sealant (item 15).
Smoke seal	Smoke seal barrier (item 11) was attached to C-purlins of the test rig (item 5) with screw fixings (item 24) at approximate 600 mm centres. PET insulation (item 13) was installed into the 60 mm wide cavity above the barrier (item 12).
Penetration	The penetration went through holes in the single glazing (item 4) and backpans (item 1) of the second module. These were fixed to the back-pan and the window with a steel sheet (backing plate), using screws and sealant and just sealant, respectively.

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140 Test sponsor: Cladding Safety Victoria (CSV)

Revision: R2.0 Page 8 of 43



Test procedure 3.

Table 3 details the test procedure for this reaction to fire test.

Table 3 **Test procedure**

rable 3 rest proced	
Item	Detail
Statement of compliance	The ad-hoc test – which was based off ISO 13785-1:2002 - was performed to determine the reaction to fire performance of an external wall cladding when exposed to heat from a simulated external fire with flames impinging directly upon a façade. The test utilises a burner used in ISO 13785-1:2002.
Sampling / specimen selection	The laboratory was not involved in sampling or selecting the test specimen for the reaction to fire test. The results obtained during the test only apply to the test samples as received and tested by Warringtonfire.
Test duration	60 minutes
Instrumentation and equipment	21 mineral insulated metal sheathed (MIMS) Type K thermocouples with an overall diameter of 1.5 mm with the measuring junction insulated from the sheath were positioned 60 mm in front of the outer ACP face of the test specimen. Refer to Figure 1 for details on positioning.
	The incident heat flux on the top of the specimen in line with the front face of test specimen was measured using a Schmidt-Boelter type heat flux gauge with a range of 0-20 kW/m².
	The incident heat flux 500 mm behind the outer glazing's – burner side and non-burner side – was measured using two Schmidt-Boelter type heat flux gauges with a range of 0-20 kW/m².
	The incident heat flux 80 mm behind the central glazing was measured using a Schmidt-Boelter type heat flux gauge with a range of 0-20 kW/m².
	Temperatures above and below the cladding were measured by seven 100 mm × 100 mm × 0.7 mm plate thermocouples with mineral insulated metal sheathed (MIMS) Type K thermocouples with an overall diameter of 1 mm with the measuring junction electrically insulated from the sheath. The thermocouple hot junction was fixed to the geometric centre of the plate by a small steel strip made from the same material as the plate. The plate thermocouples included 97 mm × 97 mm × 10 mm inorganic insulation pads. Before the first use of the plate thermocouples, they were aged by being exposed to heat in a fire-resistance test furnace for 90 min under the standard temperature/ time curve. Refer to Figure 1 for details on positioning.
	The fire source was a propane (95% purity) gas burner 1.2 m long × 0.1 m deep × 0.15 m tall. The burner was placed on the floor below the specimen with approximately 15 mm overlap with the ACP.
Test procedure	 At least two minutes of baseline data was collected prior to burner ignition. Temperature and heat flux data was collected at 5 s intervals. The heat output from the burner was held at 300 kW for the 30 minutes. The burner was then turned off and data recorded for the next 30 minutes.
Test number	Test two of three.
Variation to test one	 The sideboard was 1 metre high for test two, while it was 300 mm for test one. The laboratory conditions during the tests may differ.

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140 Test sponsor: Cladding Safety Victoria (CSV) Revision: R2.0



4. Test measurements and results

The results from the tests are summarized below. Photographs of the specimen are included in Appendix B.



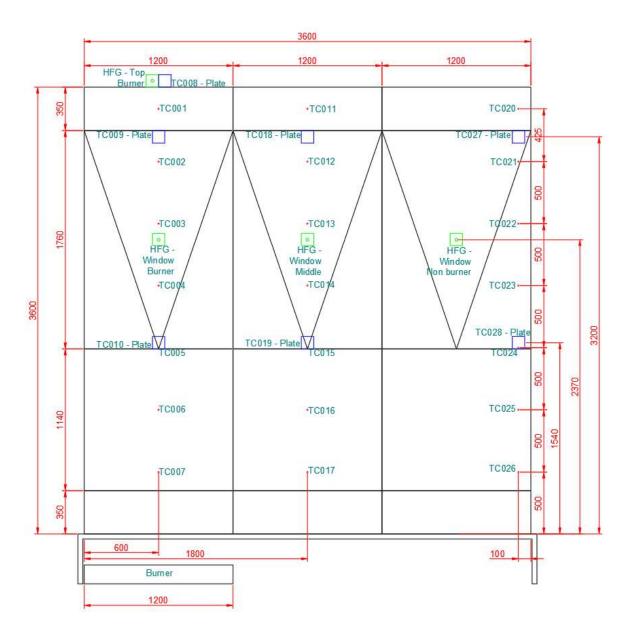


Figure 1 Instrumentation locations – front elevation

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140 Test sponsor: Cladding Safety Victoria (CSV)

Revision: R2.0 Page 10 of 43




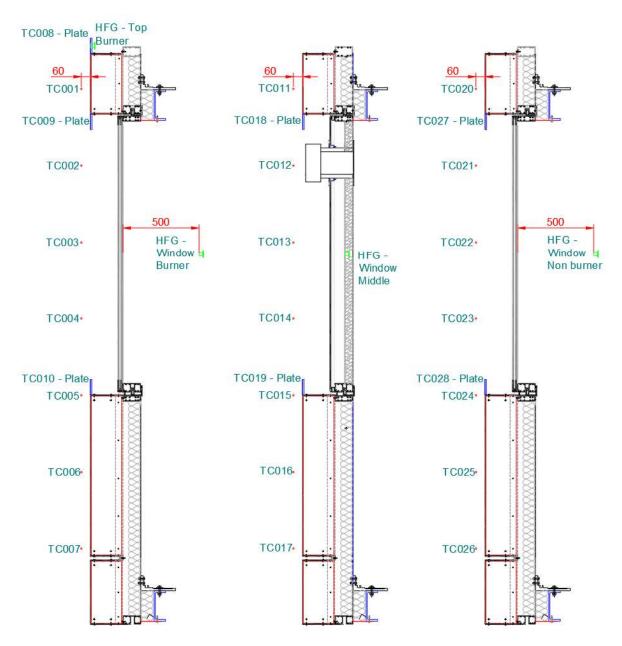


Figure 2 Instrumentation locations – sections

- 001

- 005

--- Burner off

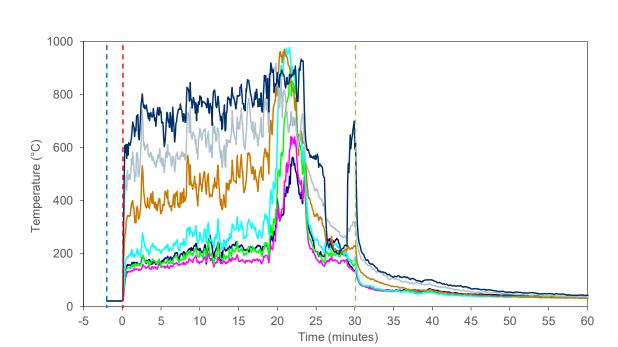

External temperature data collected by thermocouples placed 60 mm from the front face of the specimen - in-line with the burner

002

006


--- Data start

- 003

- 007

004

- - - Burner ignition

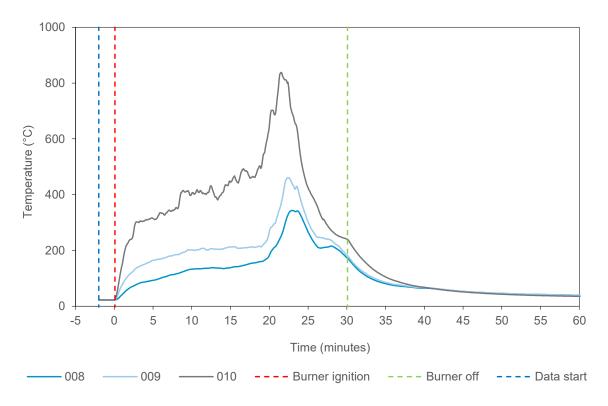

External temperature data collected by plate thermocouples in-line with ACP, above and below, respectively - in-line with the burner

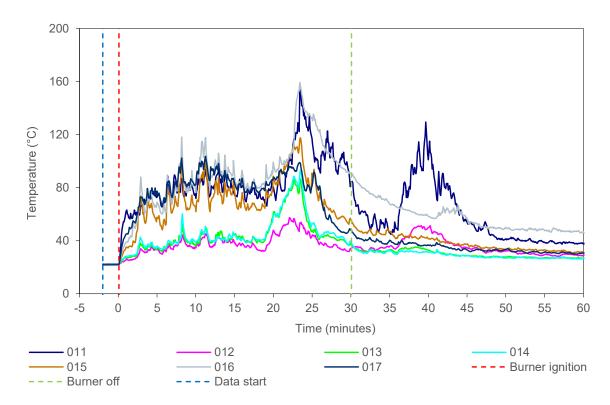


Figure 5 External temperature data collected by thermocouples placed 60 mm from the front face of the specimen – central module



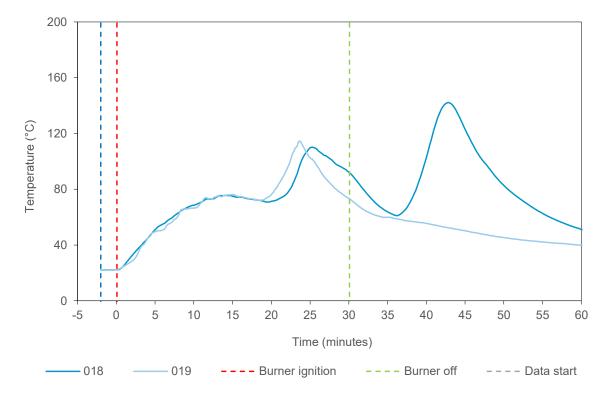


Figure 6 External temperature data collected by thermocouples in-line with ACP, above and below, respectively – central module



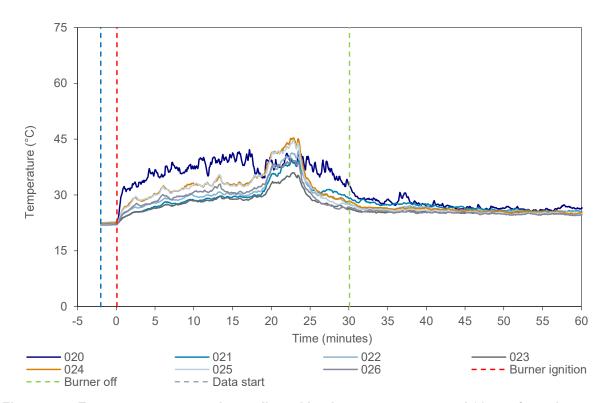

External temperature data collected by thermocouples placed 60 mm from the front face of the specimen – away from burner

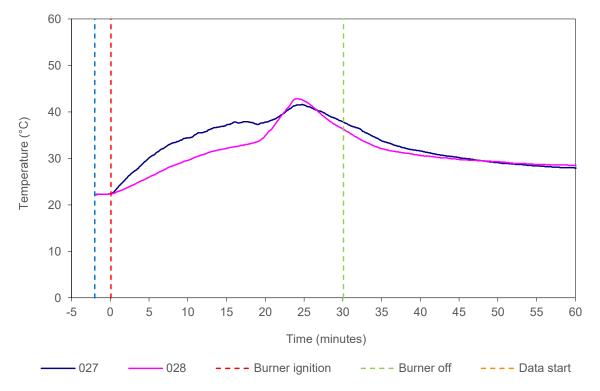

External temperature data collected by thermocouples in-line with ACP, above and Figure 8 below, respectively - away from burner



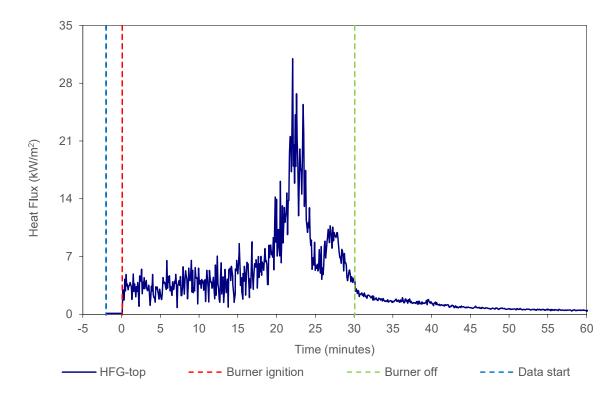


Figure 9 Heat flux data collected by heat flux gauge at the top of the specimen above the burner

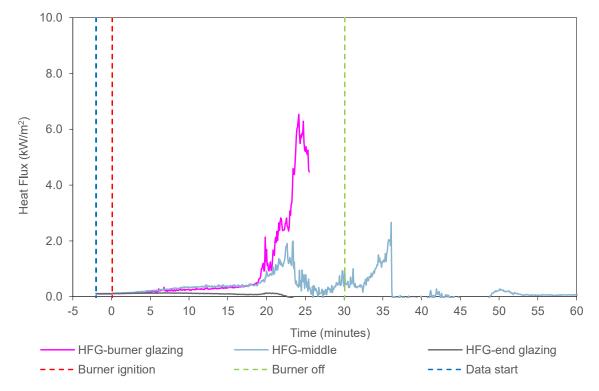


Figure 10 Heat flux data collected by heat flux gauges behind the glazing units¹

¹ The heat flux behind the glazing above the burner and the glazing at the end had a malfunction 25 minutes 30 seconds into the test. Data was collected to that point only.





Figure 11 Designation of section for the test observations

Table 4 shows the observations of any significant behaviour of the specimen during the test. Figure 11 shows the panel and glazing designations sighted in the observations.

Video recordings were also taken of the test from approximately 4 metres in front of the specimen and from 2 metres on a 45 ° angle behind the specimen. A copy of the video recording is available upon request from the test sponsor or by contacting Cladding Safety Victoria. The video of the test should be viewed in conjunction with the contents of this report.

Job number: RTF230140



Table 4 **Test observations**

Time		System	Observation
Min	Sec		
- 2	00	-	Data collection started.
0	00	-	The reaction to fire test was started with the burner ignited with a heat output set at 300 kW.
0	51	A1	The panel face started to darken.
1	06	A2/B1	The panel face started to darken.
1	14	B2/C2	Smoke started to escape from the panel to panel joint.
1	59	A1/A2	Flames started escaping through the joint.
2	27	A1	Molten droplets started to drip from the bottom corner on the west side.
3	25	A2	A buildup of gas was released from the panel.
6	28	A2	The top east corner of the of the panels started to flame independently.
8	42	A1	A buildup of gas was released from the panel.
9	32	A3	Independent flaming was observed along the bottom of the glazing.
11	32	A2	Flames started to escape from the horizontal joint between the panel halves.
12	20	A2/A1	The east edge of the panels started to open up.
13	16	A2	Smoke was escaping from the back-pan on the unexposed side of the panel.
17	15	A3	Fire started to get between the glazing layers.
18	40	A1	The front face of the specimen started to melt off.
18	58	A1	More of the front face of the specimen melted off.
19	49	А	the fire had reached the top of the specimen.
21	43	A3	Flames started to climb the east edge of the glazing, going along the height.
22	13	A3	The front glazing started to open up.
22	52	A3	More flames got between the glazing, with the back glazing starting to crack.
23	20	A3	The back glazing fell off the specimen.
24	00	A3	More of the back glazing fell off the specimen.
25	58	A3	The whole glazing had fell off the specimen.
26	35	В3	Flames started to escape from the back pan on the unexposed side.
26	50	B2	A buildup of gas was released from the panel.
30	00	-	The burner was turned off.
32	05	B1	A buildup of gas was released from the panel.
36	00	В3	Some glazing broke off and fell off the specimen.
36	54	A2/A3	The back-pan had opened up, creating an opening from the exposed to the unexposed side.
59	38	В3	The flaming at the top of the specimen had ceased.
60	00	-	The test was ended.
		1	



5. **Application of test results**

5.1 **Test limitations**

The results of these fire tests may be used to directly assess fire hazard, but it should be recognised that a single test method will not provide a full assessment of fire hazard under all fire conditions.

These results only relate to the behaviour of the specimen of the element of construction under the particular conditions of the test. They are not intended to be the sole criteria for assessing the potential fire performance of the element in use, and they do not necessarily reflect the actual behaviour in fires.

5.2 Variations from the tested specimen

This report details methods of construction, the test conditions and the results obtained when the specific element of construction described here was tested following the procedure outlined in Table 3. Any significant variation with respect to size, construction details, loads, stresses, edge or end conditions is not addressed by this report.

It is recommended that any proposed variation to the tested configuration should be referred to the test sponsor. They should then obtain appropriate documentary evidence of compliance from Warringtonfire or another accredited testing authority.

Uncertainty of measurements 5.3

Because of the nature of reaction to fire testing and the consequent difficulty in quantifying the uncertainty of measurements obtained from a reaction to fire test, it is not possible to provide a stated degree of accuracy of result.

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140

Revision: R2.0 Test sponsor: Cladding Safety Victoria (CSV) Page 18 of 43



Appendix A Drawings of test assembly

The drawings of the test assembly in Figure 12 to Figure 26 were provided by the representatives of Warringtonfire. Dimensions, unless specified, are in mm.

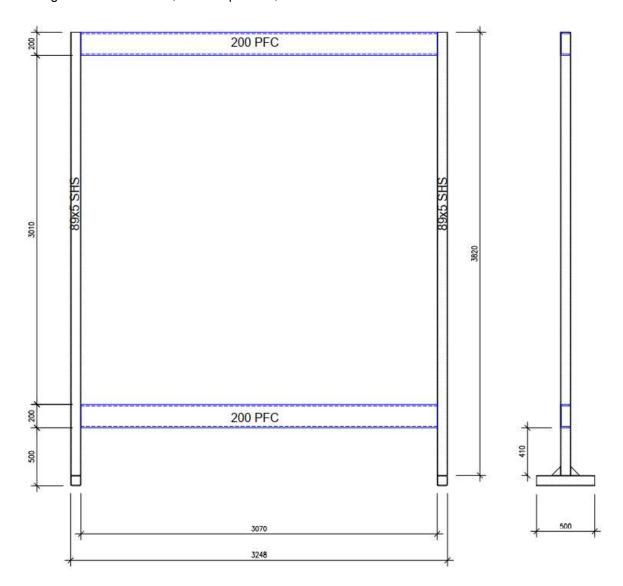


Figure 12 Elevation of rig support




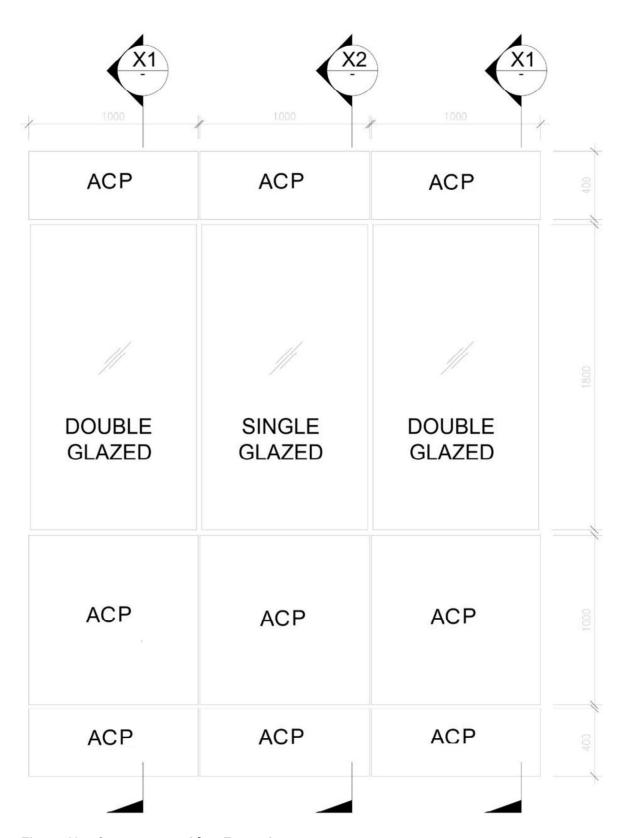


Figure 13 System assembly – Front view

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



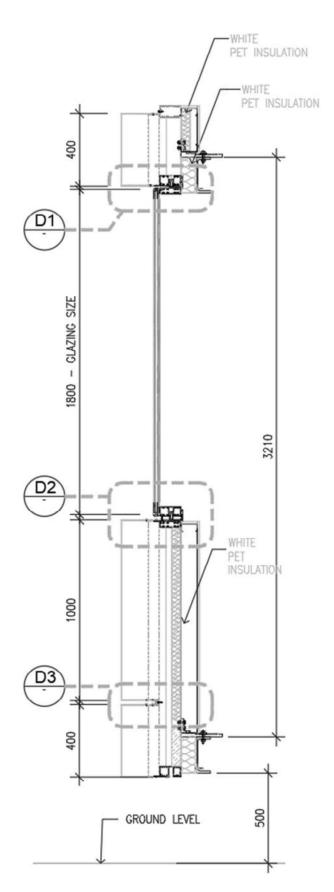

System assembly - vertical cross-sectional view X1 Figure 14

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140 Test sponsor: Cladding Safety Victoria (CSV)



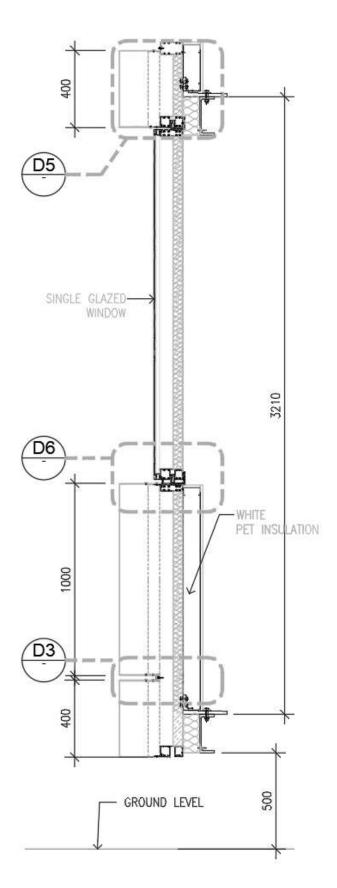


Figure 15 System assembly – vertical cross-sectional view X2

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140 Test sponsor: Cladding Safety Victoria (CSV)



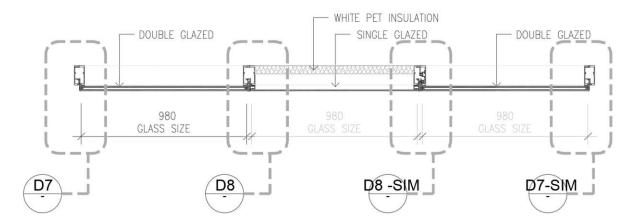


Figure 16 System assembly – horizontal mid height cross-sectional view

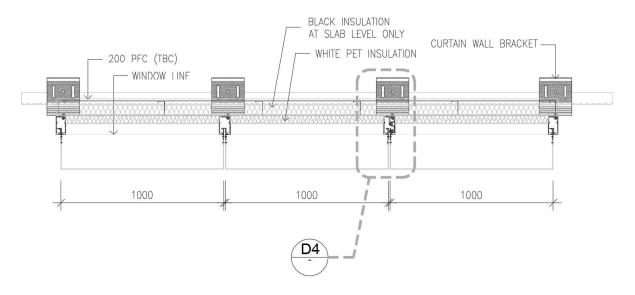


Figure 17 System assembly -top view

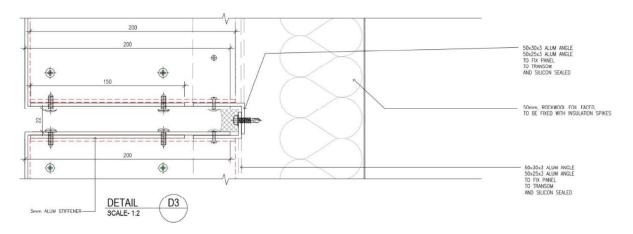


Figure 18 System assembly – Vertical cross-sectional view D3

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



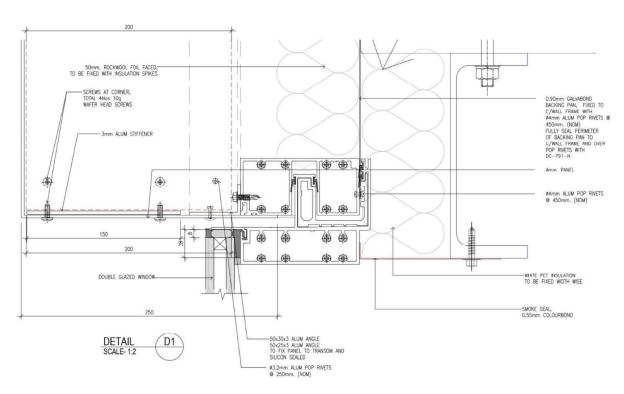


Figure 19 System assembly - Vertical cross-sectional view D1

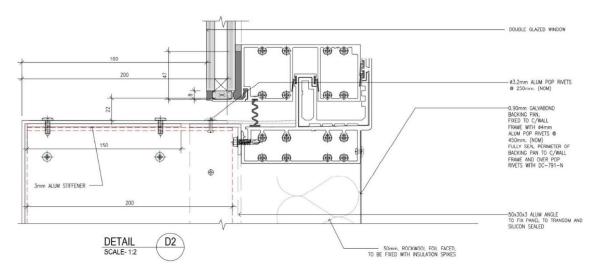


Figure 20 System assembly – Vertical cross-sectional view D2

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



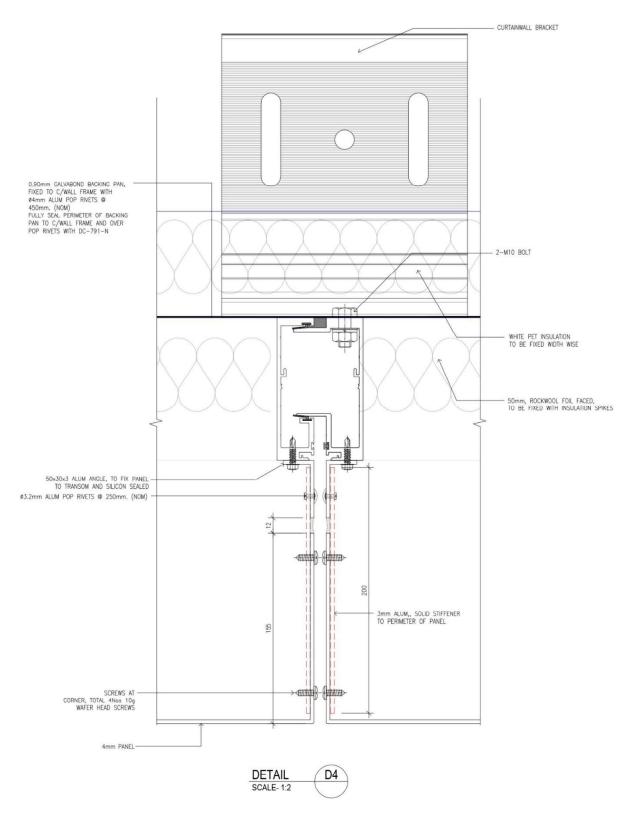


Figure 21 System assembly - Horizontal cross-sectional view D4

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140



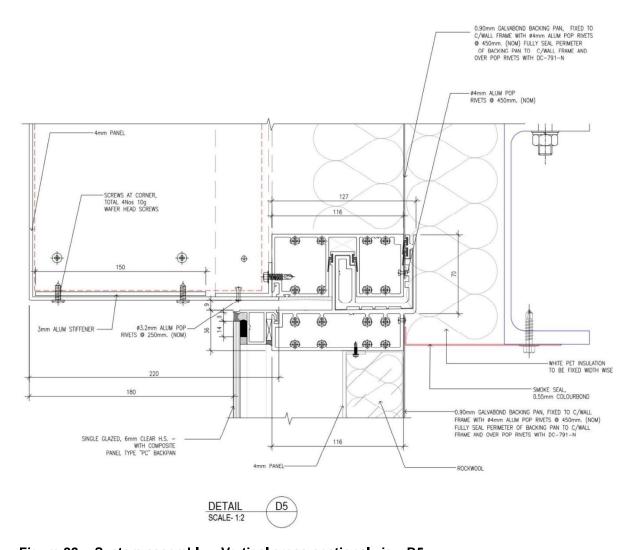


Figure 22 System assembly – Vertical cross-sectional view D5

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



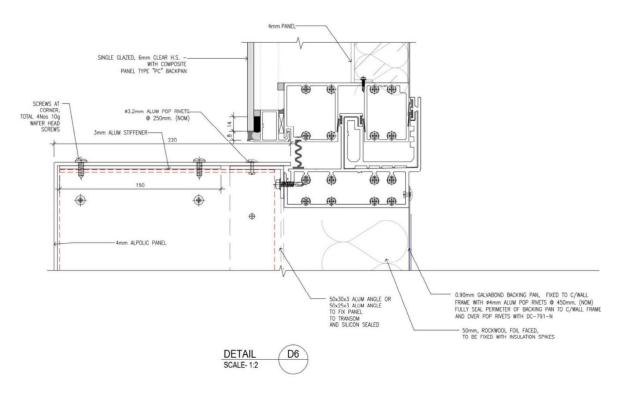


Figure 23 System assembly - Vertical cross-sectional view D6

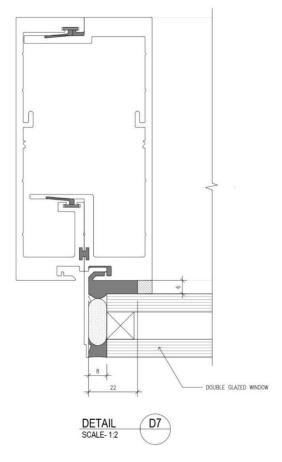


Figure 24 System assembly – vertical cross-sectional view D7

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140



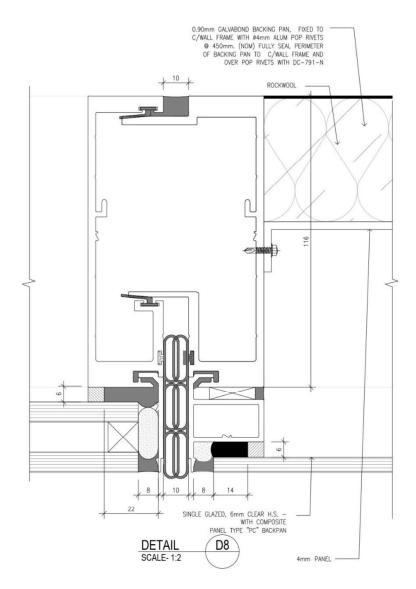


Figure 25 System assembly - vertical cross-sectional view D8

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



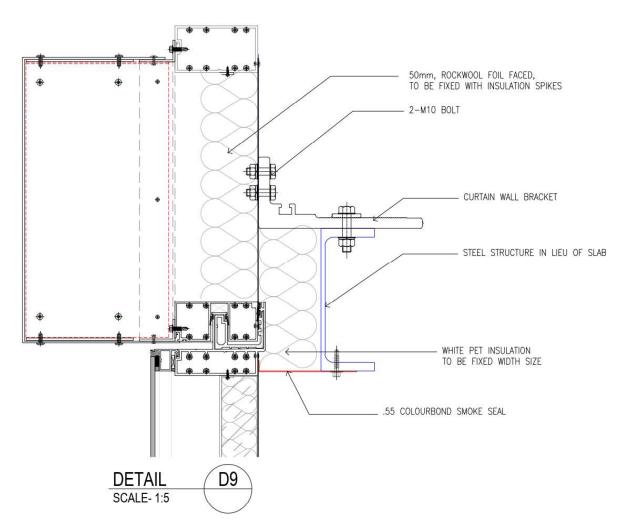


Figure 26 System assembly - vertical cross-sectional view D9



Appendix B Photographs



Figure 27 The specimen (exposed side) before the reaction to fire test



Figure 28 The specimen (unexposed side) before the reaction to fire test

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140



Figure 29 The specimen 47 seconds into the test (burner output at 300 kW)



Figure 30 The specimen 3 minutes 5 seconds into the test (burner output at 300 kW)

Job number: RTF230140



Figure 31 The specimen 6 minutes 1 second into the test (burner output at 300 kW)



Figure 32 The specimen 9 minutes 43 seconds into the test (burner output at 300 kW)

Job number: RTF230140





Figure 33 The specimen 12 minutes into the test (burner output at 300 kW)



Figure 34 The specimen 15 minutes into the test (burner output at 300 kW)

Job number: RTF230140





Figure 35 The specimen 18 minutes 39 seconds into the test (burner output at 300 kW)



Figure 36 The specimen 21 minutes 39 seconds into the test (burner output at 300 kW)

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140





Figure 37 The specimen 24 minutes 2 seconds into the test (burner output at 300 kW)



Figure 38 The specimen 26 minutes 55 seconds into the test (burner output at 300 kW)

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



Figure 39 The specimen 29 minutes 34 seconds into the test (burner output at 300 kW)



Figure 40 The specimen 30 minutes 3 seconds into the test (burner off)

Job number: RTF230140



Figure 41 The specimen 34 minutes 9 seconds into the test (burner off)



Figure 42 The specimen 36 minutes 16 seconds into the test (burner off)

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140
Test sponsor: Cladding Safety Victoria (CSV)





Figure 43 The specimen at end of test – exposed side



Figure 44 The specimen at end of test – unexposed side

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140
Test sponsor: Cladding Safety Victoria (CSV)



Appendix C Chemical analysis results



UNSW RESEARCH INFRASTRUCTURE

Chemical Consulting Laboratory

Mark Wainwright Analytical Centre UNSW Sydney NSW 2052 Australia

T: +61(2) 9348 1400 | E: ocl@unsw.edu.au W: www.analytical.unsw.edu.au/contact-us/commercial-consulting ABN 57 195 873 179 | CRICOS Provider Code 00098G

Test Report

Prepared by:

ANALYSIS OF CLADDING SAMPLES

For

Company: Warrington Fire

Contact:

Date: 22 February 2024

Project No: 24021

Prepared by:

Approved by:



Any use of the Test Report, use of any part of it, use of the names University of New South Wales or UNSW, use of the name of any Unit of UNSW, or use of the name of the consultant in direct or indirect advertising or publicity is strictly forbidden.

Project No.: 24021

Chemical Consulting Laboratory - UNSW

Page 1 of 7

This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140

Test sponsor: Cladding Safety Victoria (CSV)

Revision: R2.0

000 -

000

00

000

000

0 -000

00

Page 39 of 43





Analysis of Cladding Samples

1. SAMPLES

One envelope containing three ACP cores was received for analysis. The samples were identified as follows:

CCL sample coding	Client sample coding
24021-1	#1 - 100%
24021-2	#2 - 100%

CCL has been asked to identify the polymer and the filler (s) in the samples by FT/IR, quantitate and identify the mineral filler in the samples and classify them in accordance with the ICA cladding scheme.

2. METHODOLOGY AND RESULTS

The aluminium metals were removed from the ACPs cladding polymer, and the flat surface of the polymer sample was abraded to remove any surface adhesive. The surface of the sample was analysed directly by FTIR. The FT-IR spectra are presented in Figures 1-3.

The core of the samples was then ashed to determine their percentage mineral content (Table 1). If sufficient (>0.5 g) ash was found in the sample, it was analysed for elemental composition by X ray fluorescence spectroscopy. Results are presented in Table 2.

Table 1 Ash content of 24021-1-3

Sample coding	Ash content (w/w%)	
24021-1	3.3	
24021-2	3.0	

Project No.: 24021

Chemical Consulting Laboratory - UNSW

Page 2 of 7

This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



3. CONCLUSIONS

The cladding sample #1 consisted of 3.3% inert material and approximately 96% polyethylene polymer.

The cladding sample #1 is classified as ICA category A.

The cladding sample #2 consisted of 3.0% inert material and approximately 97% polyethylene polymer.

The cladding sample #2 is classified as ICA category A.

The ICA Classification assigned is correct as per the September 2020 revision of the ICA Guidelines.

The reader is reminded that we can only analyse and classify the content of samples actually presented to us. We can offer no guarantee that this composition or classification is valid for cladding as a whole, because some types of cladding can be inhomogeneous, and a sample may not be representative of the cladding as a whole. Anyone using our results should consider these sampling issues and uncertainties before they generalise the results we present to anybody of cladding as a whole.

Dominic D'adam BSc/BE (Hons)
Senior Technical Officer
Chemical Consulting Laboratory
Mark Wainwright Analytical Centre, UNSW
22 February 2024



Project No.: 24021


Chemical Consulting Laboratory - UNSW

Page 4 of 7


This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002 Job number: RTF230140



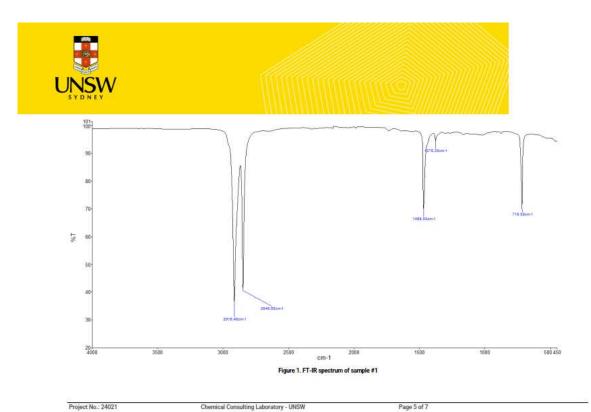

This report shall not be reproduced, except in full, without written approval of the CCL

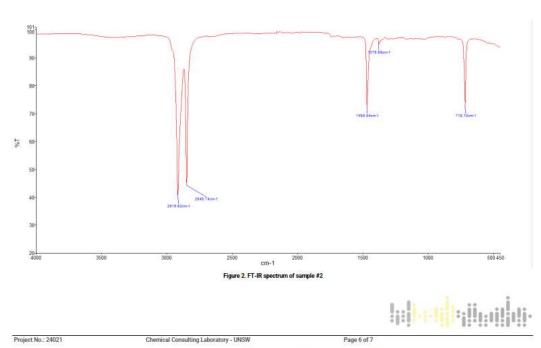

This report shall not be reproduced, except in full, without written approval of the CCL

Test standard: General accordance with ISO 13785-1:2002

Job number: RTF230140 Test sponsor: Cladding Safety Victoria (CSV) Revision: R2.0 Page 42 of 43



Warringtonfire Australia Pty Ltd ABN 81 050 241 524

Perth

Suite 4.01, 256 Adelaide Terrace Perth WA 6000 Australia T: +61 8 9382 3844

Sydney

Suite 802, Level 8, 383 Kent Street Sydney NSW 2000 Australia T: +61 2 9211 4333

General conditions of use

Canberra

Unit 10, 71 Leichhardt Street Kingston ACT 2604 Australia T: +61 2 6260 8488

Brisbane

Suite B, Level 6, 133 Mary Street Brisbane Qld 4000 Australia T: +61 7 3238 1700 Melbourne

Level 4, 152 Elizabeth Street Melbourne Vic 3000 Australia T: +61 3 9767 1000

Melbourne - NATA accredited laboratory

409-411 Hammond Road Dandenong South Vic 3175 Australia T: +61 3 9767 1000

The data, methodologies, calculations and results documented in this report specifically relate to the tested specimen/s and must not be used for any other purpose. This report may only be reproduced in full. Extracts or abridgements must not be published without permission from Warringtonfire.

All work and services carried out by Warringtonfire are subject to, and conducted in accordance with our standard terms and conditions. These are available on request.